

Ref:	NR/L2/ELP/27009/MOD C01
Issue:	1
Date:	03/12/2011
Compliance date:	03/03/2012
Page	1 of 4

OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET


01

REPLACEMENT OF CAM TYPE 753 COPPER LOOP DROPPERS


COMPONENT Original copper loop droppers as follows:
 Items 753, 753A and 753B (loop dropper with cam-type clamp);
 Items 80 and 82 (direct clip hard drawn copper loop dropper)

PROBLEM These loop droppers can come loose from the contact wire, allowing them to move along track and foul pantographs.

Item 753

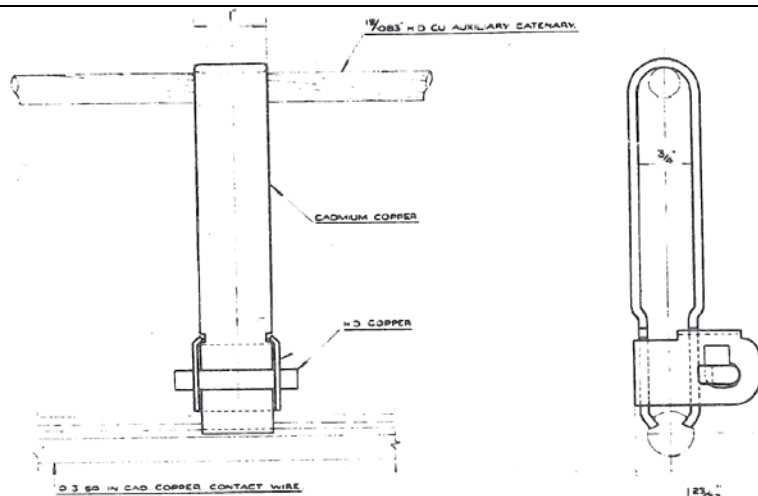

Items 80, 82

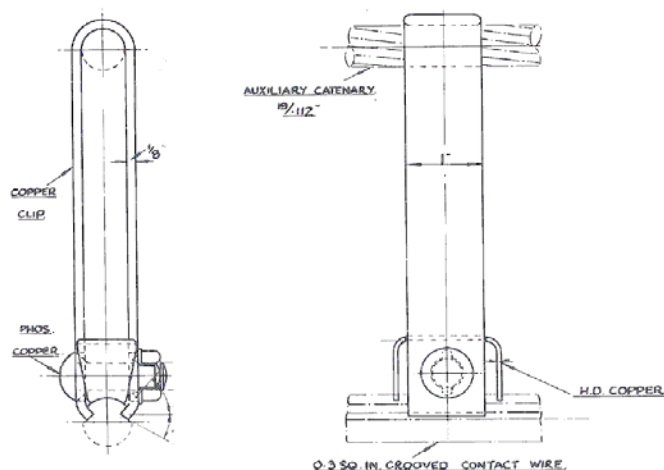

Reference Information

Ellipse standard job number	13001
Ellipse standard job description	Replace cam type dropper complete
Category	Dropper
Priority	No
Types of OLE affected	Ex DC
Original equipment dates	Before 1958



Documents
 Document Sharing Hub

Ref:	NR/L2/ELP/27009/MOD C01
Issue:	1
Date:	03/12/2011
Compliance date:	03/03/2012
Page	2 of 4

OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET

01

REPLACEMENT OF CAM TYPE 753 COPPER LOOP DROPPERS

ACTION REQUIRED

Replace 80, 82 and 753 copper loop droppers with bolted copper loop droppers to OLEMI drawing 1/997/044. The replacement droppers have the following OLEMI references:

Equipment	Reference
GE / MS main line (19/.112" aux. catenary, 193mm ² contact wire)	997/044/040 to 381
SCS main line (19/.083" aux. catenary, 193mm ² contact wire)	997/044/440 to 781

997/044

