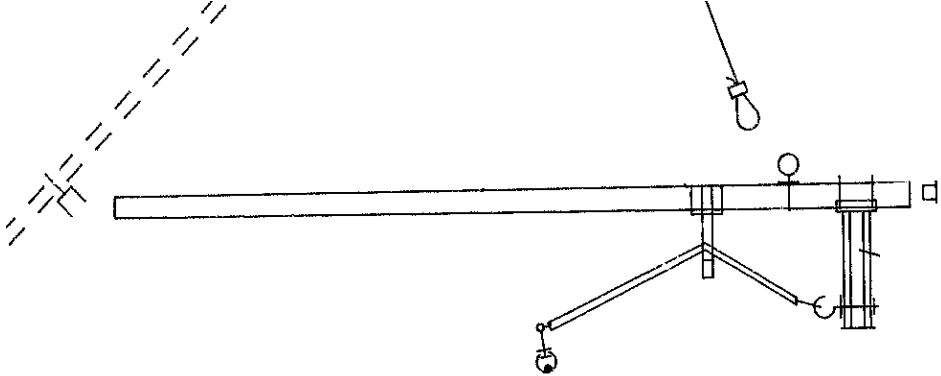
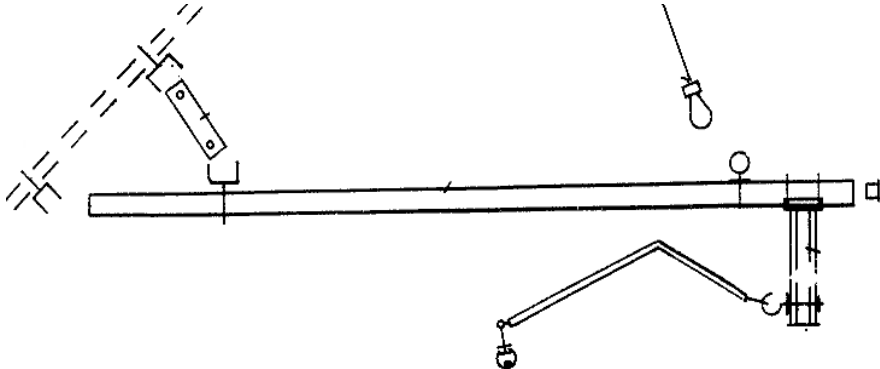


|                  |                         |
|------------------|-------------------------|
| Ref:             | NR/L2/ELP/27009/MOD C22 |
| Issue:           | 1                       |
| Date:            | 03/12/2011              |
| Compliance date: | 03/03/2012              |
| Page             | 1 of 6                  |

| OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET |                                                                                                                                                                                                                                                                                                                                                                                                                                             |
|---------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>22</b>                                   | <b>FOULING OF DEEP CURVED STEADY ARM ANTI-WIND STIRRUPS / PROTECTIVE SADDLES</b>                                                                                                                                                                                                                                                                                                                                                            |
| <b>COMPONENT</b>                            | Steady arm stirrups in high speed registration assemblies (OLEMI drawing 1/123/086).                                                                                                                                                                                                                                                                                                                                                        |
| <b>PROBLEM</b>                              | <p>These stirrups were fitted as an alternative design to windstay droppers in high speed registrations subject to large uplift. However the protective saddle moves along the registration tube and fouls the stirrup, causing the steady arm to stick in the uplifted position.</p>  <p>Stirrup and protective saddle. 123/086/001-004 143/155/001</p> |

| Reference Information            |                                    |
|----------------------------------|------------------------------------|
| Ellipse standard job number      | 13022                              |
| Ellipse standard job description | Replace anti-wind stirrup assembly |
| Category                         | Registration arm                   |
| Priority                         | No                                 |
| Types of OLE affected            | Mk3b                               |
| Original equipment dates         | 1990                               |

|                  |                         |
|------------------|-------------------------|
| Ref:             | NR/L2/ELP/27009/MOD C22 |
| Issue:           | 1                       |
| Date:            | 03/12/2011              |
| Compliance date: | 03/03/2012              |
| Page             | 2 of 6                  |

| OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET |                                                                                                                                                                                                                                                                              |
|---------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>22</b>                                   | <b>FOULING OF DEEP CURVED STEADY ARM ANTI-WIND STIRRUPS / PROTECTIVE SADDLES</b>                                                                                                                                                                                             |
| <b>ACTION REQUIRED</b>                      | <p>1. Remove the anti-wind stirrup assembly and and fit a registration tube link assembly. See drawing 199/472.</p>  <p>Remove stirrup and fit brace link. 123/086/001-004 143/155/001</p> |