

Ref:	NR/L2/ELP/27009/MOD C27
Issue:	1
Date:	03/12/2011
Compliance date:	03/03/2012
Page	1 of 4

OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET	
27	FAILURE OF CROSS SPAN WIRE TO TUBE CLAMPS WHEN DISTURBED
COMPONENT	Span wire to tube clamp ('spider' clamp), 122/022/001 (metric fixings) and 122/022/002 (BSW fixings).
PROBLEM	These clamps can deform when over tightened and can slip when re-used.
	
ACTION REQUIRED	<p>Whenever the clamps have to be adjusted or moved, replace all U-bolts, nuts, washers, liners and saddles with new items.</p> <p>Use work instruction module NR/OLE D19 of NR/L3/ELP/27237 when installing or adjusting the clamps. This describes the correct safe method to be used.</p>

Reference Information	
Ellipse standard job number	13027
Ellipse standard job description	Adjust span wire to tube (spider) clamps
Category	Span wire
Priority	Yes where clamps adjusted
Types of OLE affected	Mk3; Mk3a; Mk3b; Mk3d; Mk5
Original equipment dates	After 1970

