

Ref:	NR/L2/ELP/27009/MOD C71
Issue:	1
Date:	03/12/2011
Compliance date:	03/03/2012
Page	1 of 4

OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET	
71	BALANCE WEIGHT ANCHOR GUIDE TUBE SUPPORTS
COMPONENT	Balance weight anchor guide tube supports, as shown on 1/074/203
PROBLEM	<p>Under certain conditions, the balance weights come into contact with the square corners of the guide tube top angle support (component drawing 1/171/226) causing them to foul.</p> <p>The affected support brackets are shown on 1/171/226 revision 0 and have square corners compared with the revised bracket shown on 1/171/226 revision 2 that has the corners cut off.</p>
ACTION REQUIRED	<p>Replace with current OLEMI styles to assembly 1/074/203 and component 1/171/226. These have a revised design of guide tube support bracket with the corners cut off. In addition these have a larger tube size (48mm instead of 42mm) to allow for extra long movement of weights.</p> <p>Note that this campaign change was originally issued as a construction site instruction and is reflected on current OLEMI drawings.</p>

Reference Information	
Ellipse standard job number	13071
Ellipse standard job description	Install new design of guide tube support bracket (171/226)
Category	Tube fittings
Priority	No
Types of OLE affected	Mk3b
Original equipment dates	1990

