


Patrol Route Plan

Central Line Route CD2: Debden to Woodford (Both Roads)



R2723, Issue: A1, January 2014

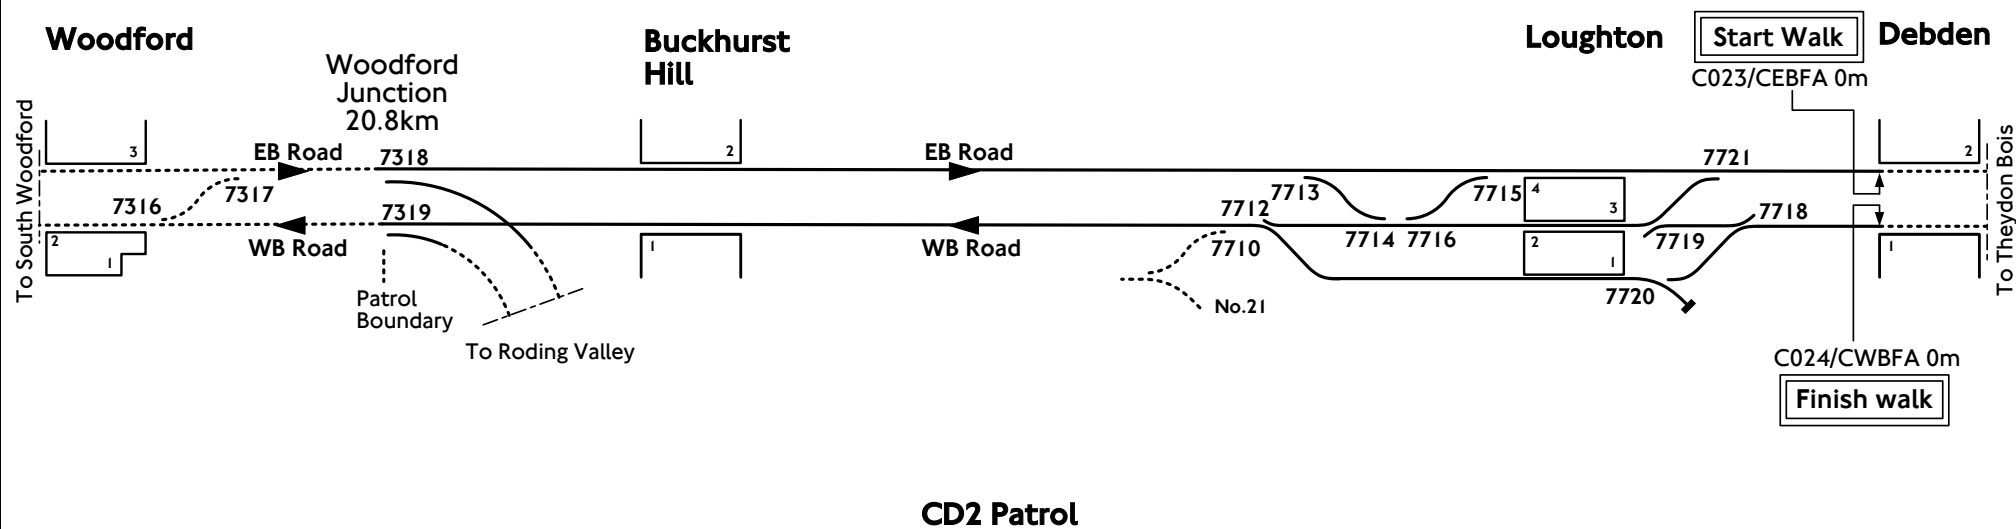

Central Line Route CD2: Debden to Woodford (Both Roads)

Patrol starts at the west end of Debden platform 2 at
LCS C023 /CEBFA 0m

Obtain briefing from supervisor and travel to Debden Station.
Set up the protection arrangements and patrol the eastbound road westwards via 7721 points, Loughton platform 4 and 7715 points to the toes of 7713 points.
Inspect all P&C associated with 7721, 7715 and 7713 points.
Patrol westwards on the eastbound road from the toes of 7713 points via Buckhurst Hill platform No 2 to the toes of 7318 points.
Inspect all P&C associated with 7318 points.
Cross to the toes of 7319 points and inspect all P&C associated with 7319 points, including the diamond of the double junction.
Patrol on the westbound road from the toes of 7319 points via Buckhurst Hill platform 1, 7710 points, 7712 points, Loughton platform 1 and 7720 points to the toes of 7718 points, to include the sand drag at 7720 points.
Inspect all P&C associated with 7710, 7712, 7720 and 7718 points.
From the toes of 7718 points, patrol the westbound road westwards via , 7719 points, Loughton platform 2/3, 7716 and 7714 points to the toes of 7712 points.
Inspect all P&C associated with 7719, 7716 and 7714 points.
From the toes of 7712 points, dead walk back to the toes of 7718 points.
Patrol eastwards on the westbound road to the west end of Debden platform 1, LCS C024/CWBFA 0m and finish the patrol.
Complete the patrol reporting process as in W1328 Patrolling the track.

Items needing particular attention

Check for:

- Broken crossing bolts, broken chairs/baseplates, safety blocks, sidecut, wear and damage and wear to P&C on 7318, 7319, 7710, 7712, 7713, 7714, 7715, 7716, 7718 , 7719, 7720 and 7721 points.
- Cracks on stretcher bars.
- Scrap and report.
- Junction plates, which should be clearly marked.
- Corrosion from dripping bridges on rails.
- Debris and ballast in all fixtures and fittings.
- Any line side storage licences which must have correct date shown.
- Broken juice pots, anchors.
- Wet beds.
- Bad top and line, bad sleeper alignment, sidecut and wear.
- Vegetation problems.
- Drainage problems.