This international standard was developed in accordance with internationally recognized principles on standardization established in the Decision on Principles for the Development of International Standards, Guides and Recommendations issued by the World Trade Organization Technical Barriers to Trade (TBT) Committee.

Designation: C1256 – 93 (Reapproved 2019)

Standard Practice for Interpreting Glass Fracture Surface Features[1]

This standard is issued under the fixed designation C1256; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 Fracture features on the surface of a crack reflect the nature and course of the fracture event associated with the breakage of a glass object. This practice is a guide to the identification and interpretation of these fracture surface features.

1.2 The practice describes the various fracture surface features as to their appearance, the process of formation and their significance.

1.3 The practice does not provide the procedural information necessary for a complete fractographic analysis. Such information is available in the general literature. (See Glossary for suggested literature).

1.4 *This international standard was developed in accordance with internationally recognized principles on standardization established in the Decision on Principles for the Development of International Standards, Guides and Recommendations issued by the World Trade Organization Technical Barriers to Trade (TBT) Committee.*

2. Referenced Documents

2.1 *ASTM Standards:*[2]

C162 Terminology of Glass and Glass Products

3. Terminology

3.1 *Definitions:*

3.1.1 *bending stress*—a continuously and linearly changing stress across the thickness of a glass body, varying from compression on one surface to tension on the opposite surface.

3.1.2 *forking*—a mechanism whereby a propagating fracture branches into two fractures, separated from each other by an acute angle.

3.1.3 *forking angle*—the angle subtended by two immediately adjacent fractures which have just branched or forked.

3.1.4 *fracture mirror constant*—a constant, characteristic of a given glass composition, which, when divided by the square root of the fracture mirror radius, will yield the fracture stress.

3.1.5 *fracture mirror radius*—a dimension of the fracture mirror as measured along the original specimen surface. It is defined as the distance from the origin to the first detectable mist.

3.1.6 *fracture surface markings*—features of the fracture surface produced during the fracture event which are useful in determining the origin and the nature of the local stresses that produced the fracture.

3.1.7 *fracture system*—the fracture surfaces that have a common cause or origin.

3.1.8 *terminal velocity*—the uppermost limiting velocity at which a crack can propagate in a material, the approach to which is marked on the fracture generated surface by the presence of mist. The terminal velocity is approximately one half the velocity of sound in the material.

3.1.9 *uniform stress*—a state of stress that does not change within the region of concern.

4. Summary

4.1 This practice is intended to aid in the identification of fracture surface markings as well as to assist in the understanding of their formation and significance.

5. Significance and Use

5.1 Fractography is often used to help identify the events that have resulted in the fracture of a glass object. This practice defines the appearance of various fracture surface features, as well as their method of formation. Thus, there can be a common understanding of their relationship to the fracture process as well as a common terminology.

6. Fracture Surface Markings

6.1 *Origin:*

6.1.1 *Identification*—The origin is almost always found at the junction where the fracture-generated surface meets a free surface or a dissimilar material. Commonly, the origin is symmetrically located near the apex of the mirror and it is

[1] This practice is under the jurisdiction of ASTM Committee C14Glass and Glass Products and is the direct responsibility of Subcommittee C14.04 on Physical and Mechanical Properties

Current edition approved Aug. 1, 2019. Published August 2019. Originally approved in 1993. Last previous edition approved in 2013 as C1256 – 93 (2013) DOI: 10.1520/C1256-93R19.

[2] For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

Copyright © ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959. United States

Documents
Document Sharing Hub
Full document details: ASTM C1256-93(2019)

usually small compared to the mirror. Fig. 1 shows typical origins and mirrors bounded by mist.

6.1.2 *Formation*—The origin represents the single, unique location at which every fracture system begins to form.

6.1.3 *Significance*—The origin defines the location where the fracture began. It may contain the stress concentrator or it may be the stress concentrator.

6.2 *Mist Region:*

6.2.1 *Identification*—Under low power (5 – 50 ×) magnification, it has a misty appearance. Proceeding away from the origin, it becomes more fibrous in appearance and elongated in the direction of crack spread. (See Fig. 2.)

6.2.2 *Formation*—It is produced as the crack front breaks into numerous segments, which then round into one another. Their propagation aborts as the crack front approaches terminal velocity.

6.2.3 *Significance*—It defines the limit of the mirror region and indicates that the crack has nearly reached terminal velocity, or both.

6.3 *Mirror:*

6.3.1 *Identification*—The mirror is a smooth portion of the fracture surface surrounding the origin (see Fig. 2). It is commonly bounded by mist, but mist may not form when the local stress at the fracture front diminishes as the crack extends.

6.3.2 *Formation*—It represents the initial portion of the propagating crack where the velocity is accelerating from the origin to a value sufficient to induce turbulence at the crack front, that is, approaching terminal velocity, where mist and forking may appear.

6.3.3 *Significance*—It is often helpful in locating the origin. The shape defined by the mist boundary is indicative of the uniformity of the stress field at the time of failure, for example; an open mirror, defined by mist only along the original surface, implies bending; a semicircular mirror implies uniform tension: (See Fig. 1) The mirror dimensions may be used to calculate the stress at breakage, because the mirror radius is inversely proportional to the square of the stress at the time the mirror was formed. If the mirror is symmetrical, then use the radius to the mist boundary. To calculate the stress at breakage when the mirror is not symmetrical, the mirror radius is best determined by dividing the mirror diameter by two. A more detailed description of the relationship between the mirror and the breaking strength for various glasses is found on p. 364 of (**1**) and in (**2**) and (**3**). Further discussion on quantitative fracture analysis techniques is well summarized in (**4**).

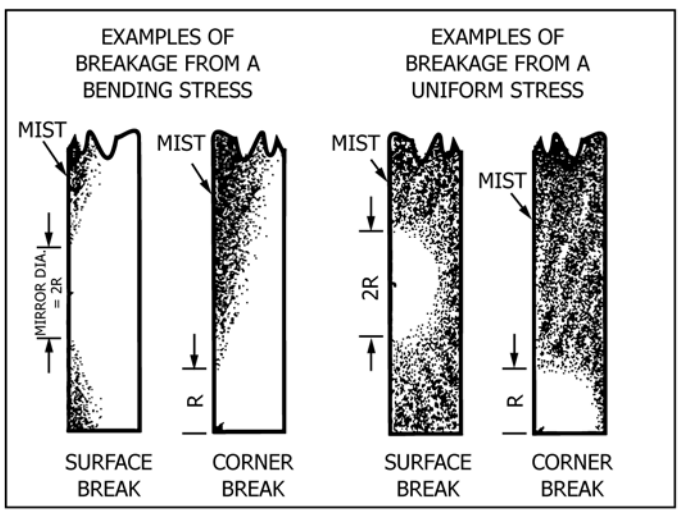

FIG. 1 Origin Areas Produced Under Various Stress Functions and Their Typical Fracture Features

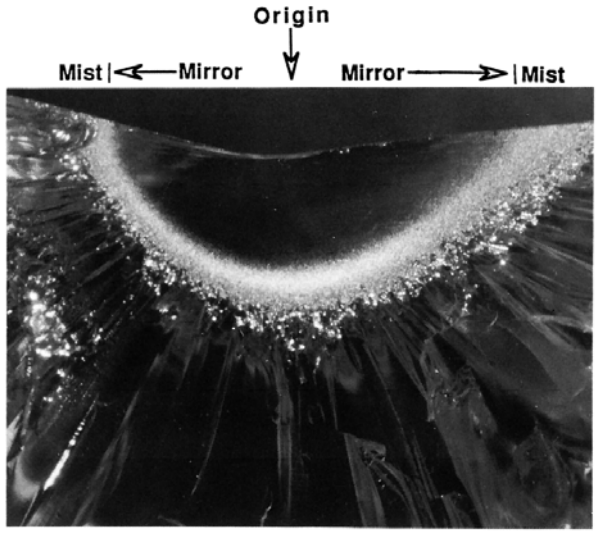

FIG. 2 An Origin Area, with Mirror and Mist

6.4 *Wallner Lines:*

6.4.1 *Identification*—Wallner lines, also called ripple marks, are rib-shaped marks, frequently appearing as a series of curved lines resembling ripples created when an object is dropped into still water. (See Figs. 3-8.)

6.4.2 *Formation*—They are produced when the plane of the propagating crack front is temporarily altered by an elastic pulse.

6.4.3 *Significance*—The direction of local propagation is perpendicular to the Wallner lines; it proceeds from the concave to the convex side of the line. The shape of the line indicates the direction of stresses at various points on the crack

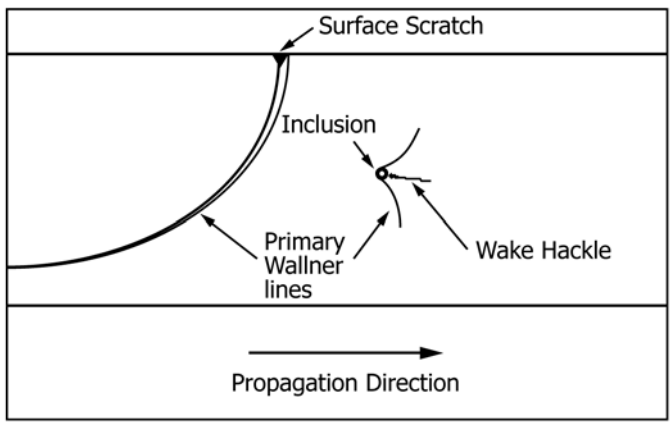

FIG. 3 Primary Wallner Lines Generated From a Surface Nonconformity and an Inclusion

AVA Documents
Document Sharing Hub

Full document details: ASTM C1256-93(2019)

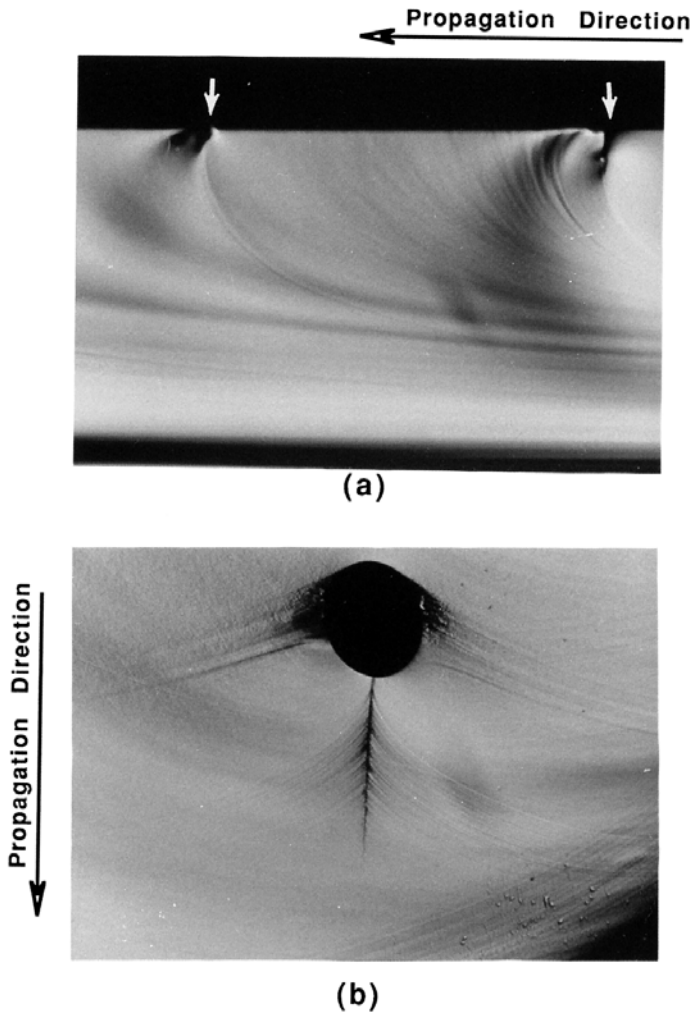

FIG. 4 Primary Wallner Lines Generated; (a) From Surface Scratches, (b) A Bubble Generating Gull Wings

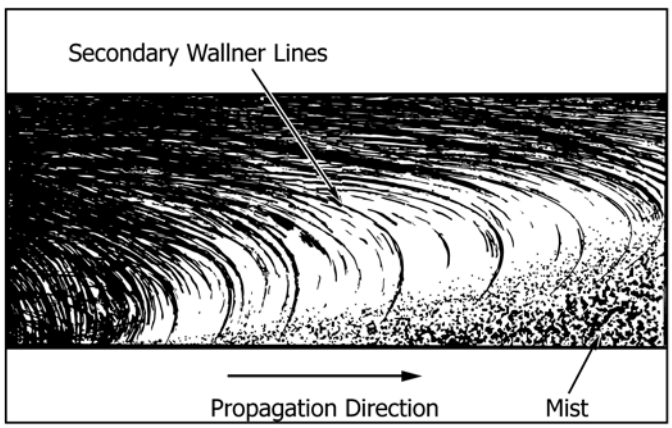

FIG. 5 Secondary Wallner Lines Generated From Mist Formation

front. The more advanced portions of the line generally correspond to regions of higher tension.

6.5 *Wallner Lines, Primary:*

6.5.1 *Identification*—Primary Wallner lines are usually quite distinct and always have their source associated with some discontinuity which was present before fracture. Examples

Documents
Document Sharing Hub

Full document details: ASTM C1256-93(2019)