



Test Method for Vulcanized Rubber and Thermoplastic Elastomer— Determination of Force Decay (Stress Relaxation) in Compression¹

This standard is issued under the fixed designation D 6147; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 This standard specifies two methods for determining the decrease in counterforce exerted by a test specimen of vulcanized rubber or thermoplastic elastomer which has been compressed at a constant deformation under specified conditions of time and temperature.

1.2 This document was developed based on testing in air and liquids.

1.3 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

2. Referenced Documents

2.1 ASTM Standards:

- D 573 Standard Test Method for Rubber—Deterioration in an Air Oven²
- D 1349 Standard Practice for Rubber—Standard Temperatures for Testing²
- D 3182 Standard Practice for Rubber—Materials, Equipment, and Procedures for Mixing Standard Compounds and Preparing Standard Vulcanized Sheets²
- D 3767 Standard Practice for Rubber—Measurement of Dimensions²
- D 4483 Standard Practice for Determining Precision for Test Method Standards in the Rubber and Carbon Black Industries²
- E 145 Specification for Gravity—Convection and Forced-Ventilation Ovens³

3. Terminology

3.1 Definitions of Terms Specific to This Standard:

3.1.1 *Compressive Stress, n* —the time-dependent force necessary to maintain a constant compressive strain, divided by the original cross-sectional area over which the force is applied.

3.1.2 *Force Decay, n* —the decrease in stress which has occurred after a specified time-interval, during application of a constant deformation, expressed as a percentage of the stress at the commencement of that time-interval. (Stress relaxation is a synonym.)

4. Summary of Test Method

4.1 *Method A*—The test specimen is compressed at the test temperature, and it is maintained at this temperature throughout the test period, all force measurements being made at the test temperature.

4.2 *Method B*—The test specimen compression and the initial measurement of the counterforce take place at $23 \pm 2^\circ\text{C}$ ($73 \pm 4^\circ\text{F}$); the test specimen is then stored in a chamber controlled at the test temperature, but it is removed from the chamber for each of the subsequent force measurements, which are made at $23 \pm 2^\circ\text{C}$ ($73 \pm 4^\circ\text{F}$).

4.3 The two methods, A and B, of carrying out the measurement do not give the same values of force decay and comparison of values obtained from the two methods must be avoided. The method selected for use depends on the purpose of the test. Thus, for fundamental studies and in applications where sealing at elevated temperatures is a problem, method A may be preferred, and in applications where temperature cycling from normal to an elevated temperature is a problem, method B may be preferred.

5. Significance and Use

5.1 When a constant strain is imposed on rubber, the force necessary to maintain that strain is not constant but decreases with time; this phenomenon is called force decay (stress relaxation). Conversely, when rubber is subjected to a constant stress, an increase in the deformation takes place in time; this behavior is called creep. These phenomena are of practical significance in rubber articles, such as seals and gaskets.

5.2 The processes responsible for force decay may be either physical or chemical in nature, and under all normal conditions both processes will occur simultaneously. However, at ambient or low temperatures and/or short times, force decay is dominated by physical processes, while at elevated temperatures and/or long times, chemical processes are dominant. Hence, it is neither safe to extrapolate time/force decay curves in order to predict force decay after periods considerably longer than

¹ This practice is under the jurisdiction of ASTM Committee D-11 on Rubber and is the direct responsibility of Subcommittee D11.14 on Time and Temperature—Dependent Physical Properties.

Current edition approved July 10, 1997. Published January 1998.

² Annual Book of ASTM Standards, Vol 09.01.

³ Annual Book of ASTM Standards, Vol 14.02.

those covered by the test, nor to use tests at higher temperatures as accelerated tests to give information on force decay at lower temperatures.

5.3 In addition to the need to specify the temperature and time-intervals in a force decay test, it is also necessary to specify the initial stress and the previous mechanical history of the test specimen, since these may also influence the measured force decay, particularly in rubbers containing fillers.

6. Apparatus

6.1 *Compression Device*, consisting of two parallel, flat plates, between the faces of which the test specimens are compressed. The two devices shown schematically in Fig. 1 and Fig. 2 were found to be acceptable through interlaboratory testing. Material of construction of the jig shall not be subject to attack from the test environment (for example acidic oil).

6.2 The finish of the surface of the compression plates shall not exceed $0.6\ \mu\text{m}$ (24 micro inches) arithmetical mean deviation from the mean line of the profile. The plates shall be sufficiently rigid to withstand the stress without bending, and of sufficient size to ensure that the whole of the compressed test specimen is within the area of the plates.

6.3 The compression device shall be connected with suitable equipment for compressing the test specimen to the specified compression within 30 s. It shall be capable of setting and maintaining the compression during the whole duration of test and shall be such that it can be kept in an oven at the specified test temperature. Care shall be taken to ensure that there is no loss of heat from the test specimen, for example by conduction through metal parts which are connected with the outside of the oven.

6.4 *Counterforce measuring device*, capable of measuring compression forces in the desired range with an accuracy of $\pm 1\%$. The device may be such as to contain the test specimens during the whole duration of the test, in which case continuous measurements are possible. Alternatively, a testing machine may be used in which the counterforce is measured after prescribed time-intervals on test specimens, compressed in a suitable jig, by applying a slight increase in the compression of the test specimen. This additional compression shall be as small as possible and in no case more than a force of 1N or half percent ($\frac{1}{2}\%$) of original load for balance type machine and 0.1 mm (0.004 in) or 2 % of original deflection for stress-strain type machines, in a time not greater than 30 s after commencing the additional compression.

6.5 *Oven*, with temperature control to maintain the specified temperature within the prescribed tolerances. Satisfactory circulation of the air shall be maintained by means of a fan (D 573 or E 145).

6.6 *Temperature reading device (optional)*, with for example a thermocouple as the sensing element, mounted in a central position in the oven.

7. Test Specimen

7.1 *Type of Test Specimen*—The test specimen shall be one of the following:

7.1.1 A cylindrical disc of diameter $13.0 \pm 0.5\ \text{mm}$ ($0.512 \pm 0.020\ \text{in}$) and thickness $6.3 \pm 0.3\ \text{mm}$ ($0.248 \pm 0.012\ \text{in}$).

7.1.2 Cylindrical disc of diameter $29.0 \pm 0.5\ \text{mm}$ ($1.142 \pm$

$0.020\ \text{in}$) and thickness $12.5 \pm 0.5\ \text{mm}$ ($0.492 \pm 0.020\ \text{in}$).

7.1.3 Washer of $12.5 \pm 0.5\ \text{mm}$ ($0.492 \pm 0.020\ \text{in}$) inside diameter and $19.0 \pm 0.5\ \text{mm}$ ($0.748 \pm 0.020\ \text{in}$) outside diameter with $2.0 \pm 0.2\ \text{mm}$ ($0.080 \pm 0.008\ \text{in}$) thickness. Within the sample test specimens, thickness variation shall be within $0.025\ \text{mm}$ ($0.001\ \text{in}$).

7.1.4 Other test specimen sizes may be used as dictated by end use.

7.2 The first three test specimens described above were evaluated in interlaboratory testing. The washer type test specimen (7.1.3) is preferred.

7.3 *Preparation of Test Specimens*—Test specimens may be prepared by taking a sample of the compound or material of interest. If this is a compound it shall be cured and molded in accordance with D 3182, or prepared by cutting from molded sheets. Cutting is carried out by means of a sharp, rotating, circular die or revolving knife, lubricated with soapy water, and brought carefully into contact with the rubber. Alternatively, the die or knife is kept stationary and the rubber rotated against it. The rubber is mounted on suitable backing material and the cutting pressure is kept small enough to avoid “cupping” of the cut surface.

7.4 Due to shape factor effect, equivalent results may not be obtained for the different test specimen shapes described above.

7.5 *Number of Test Specimens*—At least three test specimens shall be used for each test.

7.6 *Time-Interval Between Vulcanization and Testing*—The time-interval between vulcanization and testing shall be at least 24 h at ambient conditions.

8. Procedure

8.1 Carefully clean the operating surfaces of the compression device. The test specimen surface shall be free from mold release agent or dusting powder.

8.2 Measure the thickness of each test specimen at the central portion with an accuracy of $0.01\ \text{mm}$ ($0.0004\ \text{in}$). The thickness shall be determined according to D 3767.

8.3 Method A

8.3.1 Preheat the compression device to the test temperature.

8.3.2 Preheat the test specimen to the test temperature in accordance with D 1349. A preheating period of $30_{-0}^{+2}\ \text{min.}$ is recommended.

8.3.3 Compress the preheated test piece by $25 \pm 1\%$ in the compression device (6.1) at the test temperature; use a compression of $15 \pm 1\%$ if a compression of 25 % cannot be obtained. Apply the compression within 30 s. When reached, the final compression shall be fixed and maintained during the entire test period (apart from the further small compression which may be used for measurement of counterforce, mentioned in 6.4).

8.3.4 After the compression has been applied for $30_{-0}^{+2}\ \text{min.}$, measure the counterforce with an accuracy of $\pm 1\%$, still at the test temperature.

8.3.5 Repeat the measurement of the counterforce after different times, according to 10.1. Take all measurements at the test temperature.

8.3.6 Due to operator variability, all counterforce

Item	Description
A	Sample
B	Spacer (Specified by Customer)
C	Nut
D	Flange
E	Pillar
F	Clamp
G	Outer Spring Spacer
H	Spacer
I	Adjusting Screw
J	Contact Housing Assy.
K	Inner Spring Spacer
L	Springs
M	Platen

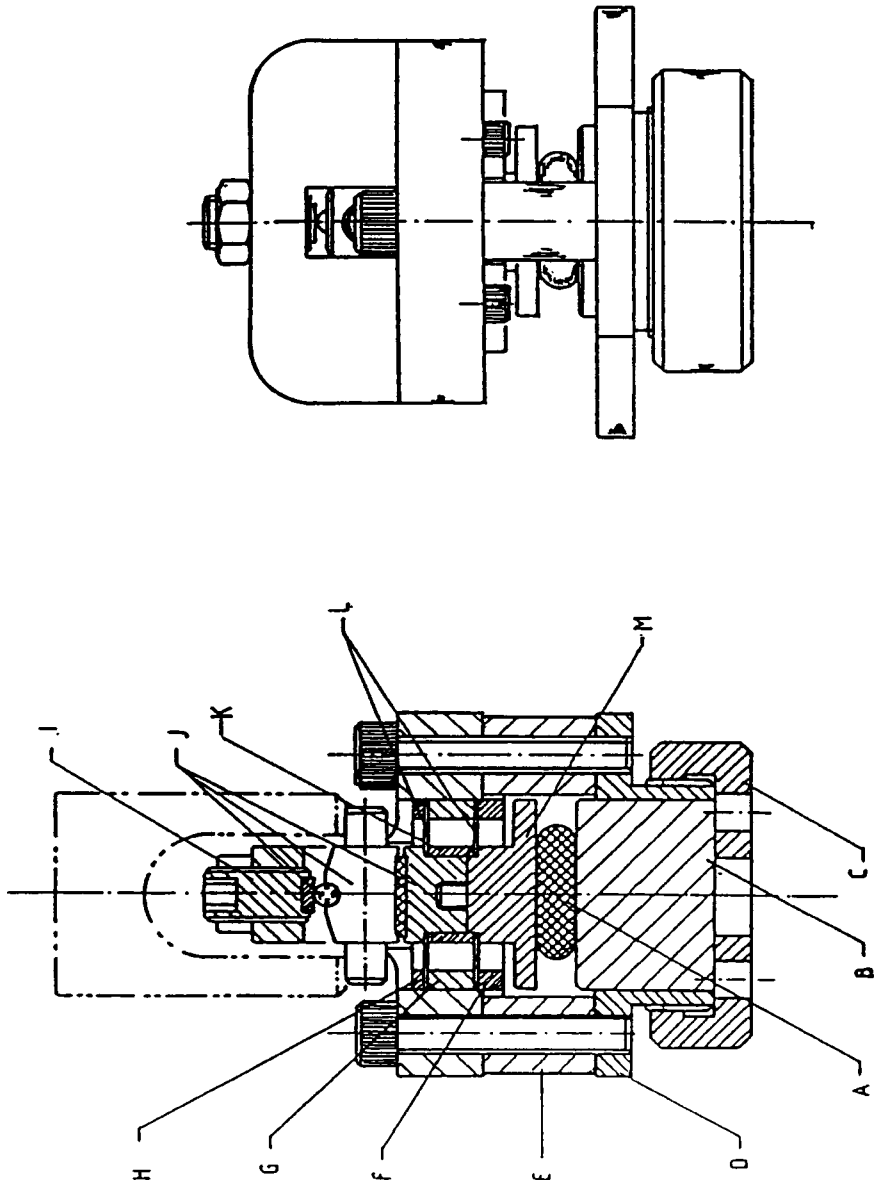


FIG. 1 Shawbury-Wallace Stress Relaxation Fixture