

Methods of sampling iron ores —

Part 2: Mechanical method of increment sampling and sample preparation

[ISO title: Iron ores — Increment sampling and sample
preparation — Mechanical method]

UDC 622.341.1:620.113.41:620.179.12

Committees responsible for this British Standard

The preparation of this British Standard was entrusted by the Iron and Steel Standards Committee (ISM/-) to Technical Committee ISM/58 upon which the following bodies were represented:

- British Steel Industry
- Institution of Mining and Metallurgy
- Mechanical Handling Engineers' Association

This British Standard, having been prepared under the direction of the Iron and Steel Standards Committee, was published under the authority of the Board of BSI and comes into effect on 23 December 1987

© BSI 12-1999

The following BSI references relate to the work on this standard:
Committee reference ISM/58
Draft for comment 85/42460 DC

ISBN 0 580 16292 3

Amendments issued since publication

Amd. No.	Date of issue	Comments

Contents

	Page
Committees responsible	Inside front cover
National foreword	iii
1 Scope	1
2 Field of application	1
3 References	1
4 Definitions	1
5 General procedure for sampling and sample preparation	2
6 Fundamentals of sampling	3
7 Method of sampling	5
8 Method of sample preparation	10
9 Packing and marking of sample	18
10 Requirements for mechanical systems	18
11 Installation for mechanical systems	21
Annex A Equation for number of increments	29
Annex B Procedure for determining the minimum mass of divided gross sample for size determination using other mechanical division methods (for example mechanical riffle divider)	30
Annex C Alternative method of taking the reference sample	32
Annex D Design criteria of primary sampler for avoiding bias in taking increments	38
Figure 1 — The precision of sampling for each mass of consignment	7
Figure 2 — Minimum number of increments required	8
Figure 3 — An example for constitution of subsample and a gross sample	11
Figure 4 — Sample preparation for chemical analysis	17
Figure 5 — An example of sample preparation	19
Figure 6 — Examples of diagrammatic illustration for cutter-type primary samplers	22
Figure 7a) — Example of slotted belt type divider	25
Figure 7b) — Example of chain bucket type divider	25
Figure 7c) — Example of rotary cutter-chute type divider	26
Figure 7d) — Example of rotary container type divider	27
Figure 7e) — Example of rotary cone type divider	27
Figure 7f) — Example of rotary plate type divider	27
Figure 7g) — Example of mechanically charged riffle type divider	27
Figure 8 — Example of flowsheet for installation	28
Figure 9 — Scheme 1	34
Figure 10 — Scheme 2	35
Figure 11 — Scheme 3	36
Figure 12 — Scheme 4	37
Table 1 — Overall precision, β_{SDM} (%)	3
Table 2 — Mass of increment	4
Table 3 — Classification of quality variation, σ_w	5
Table 4 — Minimum number of increments required, n_1 , and sampling precision, β_s	6
Table 5 — Minimum number of parts per consignment for moisture determination	12

	Page
Table 6 — Examples of minimum mass of divided size gross sample in other mechanical division methods (for example mechanically charged riffle divider) and division precision, β_{DM}	14
Table 7 — Examples of minimum mass of divided increment or subsample for size determination in other mechanical division methods (for example mechanically charged riffle divider)	14
Table 8 — Minimum mass of divided gross sample for moisture determination and/or chemical analysis for other mechanical division methods (for example mechanically charged riffle divider)	15
Table 9 — Minimum mass of divided individual increment of subsample for moisture determination and/or chemical analysis for other mechanical division methods (for example mechanically charged riffle divider)	15
Table 10 — Number of test portions for moisture determination	16
Table 11 — Value of σ_w	30
Publications referred to	Inside back cover

National foreword

This Part of BS 5660 has been prepared under the direction of the Iron and Steel Standards Committee. It is identical with ISO 3082:1987 “*Iron ores — Increment sampling and sample preparation — Mechanical method*”, published by the International Organization for Standardization (ISO).

Terminology and conventions. The text of the International Standard has been approved as suitable for publication as a British Standard without deviation. Some terminology and certain conventions are not identical with those used in British Standards; attention is drawn especially to the following.

The comma has been used as a decimal marker. In British Standards it is current practice to use a full point on the baseline as the decimal marker.

Wherever the words “International Standard” appear, referring to this standard, they should be read as “Part of BS 5660”.

Cross-references

International Standard	Corresponding British Standard
ISO 3081:1986	BS 5660 <i>Methods of sampling iron ores</i> Part 1:1987 <i>Manual method of increment sampling</i> (Identical)
ISO 3083:1986	BS 5661:1987 <i>Method for preparation of samples of iron ores by manual means</i> (Identical)
ISO 3084:1986	BS 5662 <i>Evaluation of sampling methods for iron ores</i> Part 1:1987 <i>Experimental methods for evaluation of quality variation</i> (Identical)
ISO 3085:1986	Part 2:1987 <i>Experimental methods for checking the precision of sampling</i> (Identical)
ISO 3086:1986	Part 3:1987 <i>Experimental methods for checking the bias of sampling</i> (Identical)
ISO 3087:1987	BS 5663 <i>Methods of testing iron ores</i> Part 1:1987 <i>Determination of moisture content</i> (Identical)
ISO 4701:1985	Part 2:1987 <i>Determination of size distribution by sieving</i> (Identical)

A British Standard does not purport to include all the necessary provisions of a contract. Users of British Standards are responsible for their correct application.

Compliance with a British Standard does not of itself confer immunity from legal obligations.

Summary of pages

This document comprises a front cover, an inside front cover, pages i to iv, pages 1 to 38, an inside back cover and a back cover.

This standard has been updated (see copyright date) and may have had amendments incorporated. This will be indicated in the amendment table on the inside front cover.

1 Scope

This International Standard gives

- a) the underlying theory;
- b) the basic principles for sampling and preparation of samples;
- c) the basic requirements for the design, installation and operation of the sampling system

for mechanical sampling and mechanical preparation of samples, or combination of mechanical and manual sampling and preparation of samples, to be taken from a consignment of an iron ore while being transferred for the purpose of determining the quality characteristics of the consignment.

The theory and basic principles given herein are similar to those given in ISO 3081 and ISO 3083.

This International Standard should be read in conjunction with the International Standards listed in clause 3.

2 Field of application

The methods specified are applicable to all iron ores, whether natural or processed (for example concentrates and agglomerates, such as pellets, sinters or briquettes).

The methods are applicable to both the loading and discharging of a consignment by means of belt conveyors and other ore handling equipment to which a mechanical sampler may be installed.

Samples are prepared for the determination of the following quality characteristics: size distribution, moisture content, chemical composition and physical properties.¹⁾

3 References

ISO 3081, *Iron ores — Increment sampling — Manual method*.

ISO 3083, *Iron ores — Preparation of samples — Manual method*.

ISO 3084, *Iron ores — Experimental methods for evaluation of quality variation*.

ISO 3085, *Iron ores — Experimental methods for checking the precision of sampling*.

ISO 3086, *Iron ores — Experimental methods for checking the bias of sampling*.

ISO 3087, *Iron ores — Determination of moisture content of a consignment*.

ISO 4701, *Iron ores — Determination of size distribution by sieving*.

4 Definitions

For the purpose of this International Standard, the following definitions apply.

4.1

lot

a definite quantity of an ore, processed or produced under conditions which are presumed uniform

4.2

consignment

a quantity of an ore delivered at one time. The consignment may consist of one or more lots or parts of lots

4.3

increment

- 1) A quantity of an ore taken by a sampling device at one time from a consignment.
- 2) A quantity taken in the increment division method (also referred to as cut).

4.4

subsample

- 1) A quantity of an ore consisting of two or more increments taken from a part of the consignment.
- 2) An aggregation of two or more increments each of which individually has been optionally crushed and/or optionally divided as necessary.

4.5

gross sample

- 1) The quantity of an ore consisting of all the increments taken from a consignment.
- 2) An aggregation of all the increments or all the subsamples each of which individually has been optionally crushed and/or optionally divided as necessary.

4.6

divided sample

a sample obtained by a method of division

4.7

test sample

a sample ready for determination of size distribution, moisture content, chemical composition or other physical properties, which is prepared from each increment, each subsample, or from the gross sample in accordance with the specified method for that type of sample

a representative part of a test sample which is actually subjected to the test is designated the **test portion**. If the entire quantity of a test sample is subjected to the test, the test sample may also be called "test portion"

¹⁾ The sampling and sample preparation of iron ores for physical testing will form the subject of a future International Standard.

4.8**sample for size determination; size sample**

the sample taken for the determination of size distribution of the consignment or part of the consignment

4.9**sample for moisture determination; moisture sample**

the sample taken for the determination of moisture content of the consignment or part of the consignment

4.10**sample for chemical analysis**

the sample taken for the determination of chemical composition of the consignment or part of the consignment

4.11**sample for physical testing**

the sample taken for the determination of physical properties of the consignment or part of the consignment

4.12**maximum particle size**

the size of opening of the sieve on which approximately 5 % (m/m) of iron ore is retained

NOTE It is essential to ascertain the maximum particle size of the consignment either from past experience or by experiment. However, if no information is available, visual estimation is acceptable.

4.13**whole-through sieve size**

the size of the smallest sieve aperture through which all of a sample passes

4.14**stratified sampling**

for a consignment which can be divided into strata, sampling carried out in such a way that specified proportions of the sample are drawn from different strata

NOTE The stratum is a part of a consignment which is derived by division of the consignment according to specific criteria.

4.15**periodic systematic sampling**

sampling in which increments are taken from a consignment at regular intervals

when a mass interval is adopted, it is called **periodic systematic sampling on a mass basis**, and when a time interval is adopted, it is called **periodic systematic sampling on a time basis**

4.16**constant-mass division and fixed-rate division**

when plural increments or subsamples are prepared individually and constituted into subsamples or a gross sample, the division of increments or subsamples shall be conducted either by constant-mass division or by fixed-rate division at an appropriate stage of sample preparation, according to the type of sampling adopted

the **constant-mass division** is a method to obtain divided samples having almost uniform mass (coefficient of variation less than 20 %) regardless of the variation in masses of samples to be divided, and the **fixed-rate division** is a method to obtain divided samples having such masses as to be proportional to the varied masses of samples to be divided

5 General procedure for sampling and sample preparation

Sampling shall be carried out by periodic systematic sampling, either on a mass basis or on a time basis. According to the type of sampling, not only the method of sampling but also the method of sample preparation is different.

The following is the general procedure for the sampling and sample preparation:

- a) identify the consignment or part of the consignment to be sampled;
- b) ascertain the maximum particle size;
- c) determine the actual mass of increment in relation to the maximum particle size, the ore handling equipment and the mechanical device for taking increments;
- d) ascertain the quality variation, σ_w , of the consignment;
- e) determine the minimum number of increments, n_1 , required;
- f) determine the sampling interval, in tonnes, for mass-basis sampling, or in minutes, for time-basis sampling;
- g) take increments having almost uniform mass in mass-basis sampling or having a mass proportional to the flow rate of the ore stream at the time of sampling in time-basis sampling. Increments are to be taken, during the whole period of handling the entire consignment, at the intervals determined in f);
- h) determine the method of combining the increments and constitute a gross sample or subsample, if necessary;
- j) crush the sample, if necessary, except for the size sample;

- k) dry the sample, if necessary, except for the moisture sample;
- m) divide the sample according to the minimum permissible mass of sample after division, employing constant-mass or fixed-rate division for mass-basis sampling, or fixed-rate division for time-basis sampling when dividing increments or subsamples;
- n) prepare the test sample.

6 Fundamentals of sampling

6.1 Overall precision

The overall precision (denoted by β_{SDM}), at a probability level of 95 %, for determining the mean values of the iron content, moisture content and percentage undersize fraction of the consignment, measured using the relevant International Standards, shall be as shown in Table 1 or as agreed between the interested parties.

The overall precision of an intermediate mass of consignment other than those shown in Table 1 may be obtained by linear interpolation.

Variations from the other tables in this International Standard may be made, provided it can be demonstrated that the overall precision limits given in Table 1 can be met. The precision should be determined in accordance with ISO 3085. Generally for chemical elements other than iron, the values of overall precision will be smaller than that for the iron content specified in Table 1.

The overall precision, β_{SDM} , is a measure of the overall precision including sampling, sample division and measurement, and is twice the standard deviation of the overall process, σ_{SDM} , expressed as an absolute percentage, i.e.

$$\beta_{\text{SDM}} = 2\sigma_{\text{SDM}} \quad \dots (A1)$$

$$\sigma_{\text{SDM}} = \sqrt{\sigma_{\text{S}}^2 + \sigma_{\text{D}}^2 + \sigma_{\text{M}}^2} \quad \dots (A3)$$

$$\sigma_{\text{S}} = \frac{\sigma_{\text{w}}}{\sqrt{n_1}} \quad \dots (A5)$$

where

σ_{S} is the precision of sampling;

σ_{D} is the precision of sample division;

σ_{M} is the precision of measurement;

σ_{w} is the quality variation;

n_1 is the number of increments.

Equations (A1), (A3) and (A5) are based on the theory of stratified sampling (refer to Annex A for details). The number of increments to be taken for a consignment of ore is dependent on the sampling precision desired and on the quality variation of the ore to be sampled.

Therefore, before the number of increments can be determined, it is necessary to define:

- a) the sampling precision to be attained;
- b) the quality variation of the ore to be sampled.

6.2 Mass of increment

6.2.1 The average mass of increment shall be decided according to the maximum particle size of the consignment, and the value given in the fourth column of Table 2 is the minimum average mass of increment.

The actual mass of an individual increment shall be greater than the minimum mass specified in the third column of Table 2.

Table 1 — Overall precision, β_{SDM} (%)

Quality characteristics			Approximate overall precision, β_{SDM}			
			Mass of consignment (t)			
			270 000 to 210 000	70 000 to 45 000	15 000 to 5 000	≤ 500
Iron content			± 0,35	± 0,4	± 0,5	± 1,0
Moisture content			± 0,35	± 0,4	± 0,5	± 1,0
Size	– 200 mm ore	– 10 mm fraction, mean 20 %	± 3,5	± 4,0	± 5,0	± 10,0
	– 50 mm ore					
	– 31,5 + 6,3 mm sized ore	– 6,3 mm fraction mean 10 %	± 1,75	± 2,0	± 2,5	± 5,0
	Sinter feed	+ 6,3 mm fraction, mean 10 %				
	Pellet feed	– 45 µm fraction, mean 70 %				
	Pellets	– 5 mm fraction, mean 5 %				

Table 2 — Mass of increment

Maximum particle size (mm)		Minimum mass of individual increment (kg)	Minimum average mass of increment (kg)
Over	Up to and including		
150	250	190	320
100	150	40	70
50	100	12	20
20	50	4	6,5
10	20	0,8	1,3
	10	0,3	0,5

NOTE The minimum mass of individual increment is the basic requirement and the minimum average mass of increment is shown for reference.

6.2.2 The average mass of increment, $\bar{m}$, in kilograms, being taken by a cutter-type primary sampler from the ore stream on or at the discharge end of a conveyor belt is given by the equation

$$\bar{m} = \frac{q_m l_1}{3,6 v}$$

where

q_m is the average flow rate, in tonnes per hour, of the conveyor belt;

l_1 is the cutting aperture, in metres, of the primary sampler;

v is the cutter speed, in metres per second, of the primary sampler.

NOTE 1 The calculated average mass of increment, $\bar{m}$, will in the majority of cases be in excess of the minimum stated in Table 2.

NOTE 2 It is essential that $\bar{m}$ meet the minimum mass stated in Table 2 for the minimum intended flow rate, q_m , l_1 or v or both may be adjusted to achieve this.

NOTE 3 The cutter speed, v , is dependent on the type of cutter selected. Mechanical limitations provide safeguards against cutting speeds reaching the upper limit which may introduce bias.

6.2.3 When the average mass of increment has been determined, increments shall be taken in a manner which ensures that they have an almost uniform mass in mass-basis sampling (see 7.1.1) or a mass proportionate to the flow rate of ore stream at the time of sampling in time-basis sampling.

6.3 Quality variation

6.3.1 The quality variation, σ_w , is a measure of the heterogeneity of a consignment and is the standard deviation of the quality characteristics of the increments within the strata of the consignment for periodic systematic sampling being made by mass-basis sampling.

The estimated value of σ_w should be derived by experimentation for each type of iron ore and at each handling plant, under normal operating conditions in accordance with ISO 3084.

In the case of time-basis sampling, if the flow rate of the ore is uniform on the belt, then time-basis sampling is the same as mass-basis sampling and ISO 3084 can be applied.

6.3.2 The characteristics to be selected for determining quality variation are iron content, moisture content, percentage undersize fraction and in certain cases other characteristics.

6.3.3 Depending on the types of iron ore and the handling plant, the magnitudes of quality variation in terms of σ_w shall be classified into three categories as indicated in Table 3.

6.3.4 All ore whose quality variation is unknown shall be considered to have "large" quality variation.

6.3.5 If separate samples are to be taken for the determination of chemical composition, moisture content, size distribution, etc., the quality variation shall be classified for individual characteristics.

6.3.6 If the sample is to be used for the determination of more than one quality characteristic, the quality variation shall be classified for the characteristic which has the largest classification of quality variation.

6.4 Number of increments and precision of sampling

6.4.1 Mass-basis sampling

When the value of σ_w is known, then the number of increments, n_1 , can be calculated from equation (A7) at the desired sampling precision of β_s

$$n_1 = \left(\frac{2\sigma_w}{\beta_s} \right)^2 \dots (A7)$$

When the value of σ_w is classified in terms of large, medium or small quality variation in accordance with Table 3, then Table 4 shall be used to determine the minimum number of increments required for a particular consignment (see Annex A for the theoretical background).

When n_1 increments are taken according to Table 4, the precision of sampling, β_s , will be as shown in the same table. (See Figure 1 and Figure 2.)

Table 3 — Classification of quality variation, σ_w

Values as absolute percentages

Quality characteristics			Classification of quality variation		
			Large	Medium	Small
Iron content			$\sigma_w \geq 2,0$	$2,0 > \sigma_w \geq 1,5$	$\sigma_w < 1,5$
Moisture content			$\sigma_w \geq 2,0$	$2,0 > \sigma_w \geq 1,5$	$\sigma_w < 1,5$
Size	– 200 mm ore	– 10 mm fraction, mean 20 %	$\sigma_w \geq 10$	$10 > \sigma_w \geq 7,5$	$\sigma_w < 7,5$
	– 50 mm ore				
	– 31,5 + 6,3 mm sized ore	– 6,3 mm fraction, mean 10 %	$\sigma_w \geq 5$	$5 > \sigma_w \geq 3,75$	$\sigma_w < 3,75$
	Sinter feed	+ 6,3 mm fraction, mean 10 %			
	Pellet feed	– 45 μm fraction, mean 70 %	$\sigma_w \geq 3$	$3 > \sigma_w \geq 2,25$	$\sigma_w < 2,25$
	Pellets	– 5 mm fraction, mean 5 %			

6.4.2 Time-basis sampling

The sampling interval shall be determined by the maximum flow rate and Table 4, therefore the number of increments taken will be greater than that for mass-basis sampling.

7 Method of sampling

7.1 Mass-basis sampling

7.1.1 Mass of increment

7.1.1.1 The mass of increment shall be determined according to 6.2.

7.1.1.2 The mass of individual increments shall be almost uniform. “Almost uniform mass” means that the variation in mass shall be less than 20 % in terms of the coefficient of variation. The coefficient of variation (CV), expressed as a percentage, is defined as the ratio of standard deviation, s , to the mean value, $\bar{m}$, of the mass of the increments times 100

$$\frac{s}{\bar{m}} \times 100 < 20 \%$$

For example when the average mass of increment is to be 100 kg, the increments should be taken in such a manner that 95 % of the increments vary between 60 and 140 kg, with an average of 100 kg.

7.1.1.3 If the coefficient of variation in the mass of individual increments is 20 % or greater, each increment shall be subjected to division (according to the rules of division) and the quality characteristics determined. Alternatively divided increments of “almost uniform mass” may be combined at an appropriate stage of division into a subsample or a gross sample.

7.1.1.4 The increments shall be taken in such a manner as to ensure that they are of “almost uniform mass”. Because of possible variations in the handling rate, the masses of successive increments might vary. Therefore provision must be made, either in the manner in which the increments are taken, or by subsequent weighing of each increment, to ensure that they have almost uniform mass.

7.1.1.5 In order to avoid taking an increment whose mass is below the minimum mass specified in the third column of Table 2, one or more of the following measures shall be taken:

- control of the flow of ore on the conveyor belt ahead of the primary sampler;
- installation of a sensor which monitors the flow rate of the ore on the conveyor belt, to move the primary sampler only when a sufficient flow of ore is on the belt;
- installation of an apparatus which rejects the short-mass increment and re-starts the primary sampler;
- adoption of a variable speed cutter.

7.1.2 Quality variation

The quality variation should be derived by experimentation in accordance with ISO 3084.

7.1.3 Number of increments

The number of increments shall be determined as described in 6.4.1.

7.1.4 Sampling interval

7.1.4.1 The mass interval, Δm , in tonnes, between taking increments shall be calculated from the condition

$$\Delta m < \frac{m_1}{n_1}$$

where


m_1 is the mass, in tonnes, of the consignment;

n_1 is the number of increments determined in 6.4.1.

Table 4 — Minimum number of increments required, n_1 , and sampling precision, β_s

Mass of consignment (t)		Quality variation, σ_w																
		Large						Medium						Small				
		n_1	β_s %					n_1	β_s %					n_1	β_s %			
Iron content	Moisture content		Size			Iron content	Moisture content		Size			Iron content	Moisture content		Size			
			– 200 mm and – 50 mm ores, – 10 mm fraction	– 31,5 + 6,3 mm sized ores, – 6,3 mm fraction	Sinter feed, + 6,3 mm fraction				Pellet feed, – 45 μ m fraction Pellets, – 5 mm fraction	– 200 mm and – 50 mm ores, – 10 mm fraction	– 31,5 + 6,3 mm sized ores, – 6,3 mm fraction				Sinter feed, + 6,3 mm fraction	Pellet feed, – 45 μ m fraction Pellets, – 5 mm fraction	– 200 mm and – 50 mm ores, – 10 mm fraction	– 31,5 + 6,3 mm sized ores, – 6,3 mm fraction
Over	Up to and including																	
270 000		260	0,31	1,55	0,77	0,47	130	0,31	1,55	0,77	0,47	65	0,31	1,55	0,77	0,47		
210 000	270 000	240	0,32	1,61	0,80	0,48	120	0,32	1,61	0,80	0,48	60	0,32	1,61	0,80	0,48		
150 000	210 000	220	0,34	1,69	0,84	0,51	110	0,34	1,69	0,84	0,51	55	0,34	1,69	0,84	0,51		
100 000	150 000	200	0,35	1,77	0,88	0,53	100	0,35	1,77	0,88	0,53	50	0,35	1,77	0,88	0,53		
70 000	100 000	180	0,37	1,86	0,92	0,56	90	0,37	1,86	0,92	0,56	45	0,37	1,86	0,92	0,56		
45 000	70 000	160	0,39	1,98	0,98	0,59	80	0,39	1,98	0,98	0,59	40	0,39	1,98	0,98	0,59		
30 000	45 000	140	0,42	2,11	1,05	0,63	70	0,42	2,11	1,05	0,63	35	0,42	2,11	1,05	0,63		
15 000	30 000	120	0,45	2,28	1,13	0,68	60	0,45	2,28	1,13	0,68	30	0,45	2,28	1,13	0,68		
5 000	15 000	100	0,50	2,50	1,24	0,75	50	0,50	2,50	1,24	0,75	25	0,50	2,50	1,24	0,75		
2 000	5 000	80	0,56	2,80	1,39	0,84	40	0,56	2,80	1,39	0,84	20	0,56	2,80	1,39	0,84		
1 000	2 000	60	0,65	3,23	1,60	0,97	30	0,65	3,23	1,60	0,97	15	0,65	3,23	1,60	0,97		
500	1 000	40	0,79	3,96	1,96	1,19	20	0,79	3,96	1,96	1,19	10	0,79	3,96	1,96	1,19		
	500	30	0,91	4,56	2,27	1,37	15	0,91	4,56	2,27	1,37	8	0,88	4,42	2,21	1,33		

NOTE By agreement between the interested parties and where feasible, the values of n_1 may be increased or decreased. For example if the minimum number of increments is $2n_1$, then β_s will be improved by $1/\sqrt{2} = 0,71$; and if it is $n_1/2$, then β_s will be worsened by $\sqrt{2} = 1,4$.

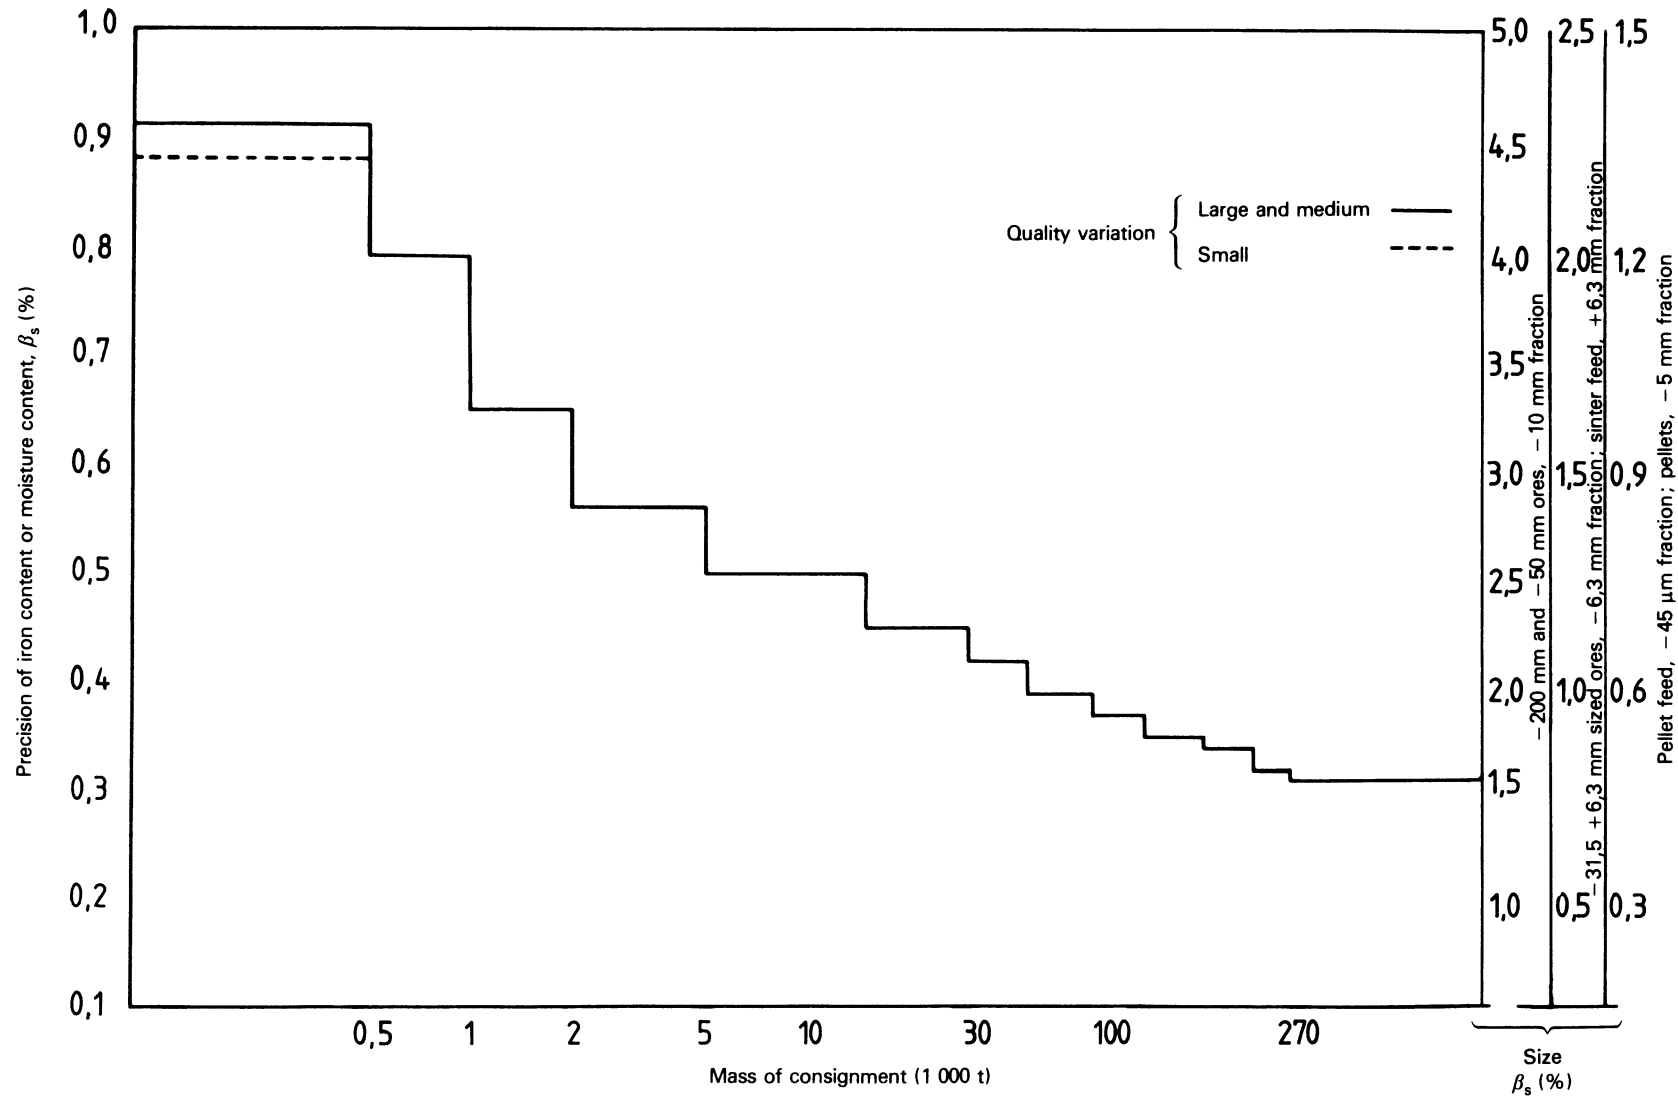


NOTE Figure 1 is a graphic illustration of β_s in Table 4.

Figure 1 — The precision of sampling for each mass of consignment



Documents

Document Sharing Hub

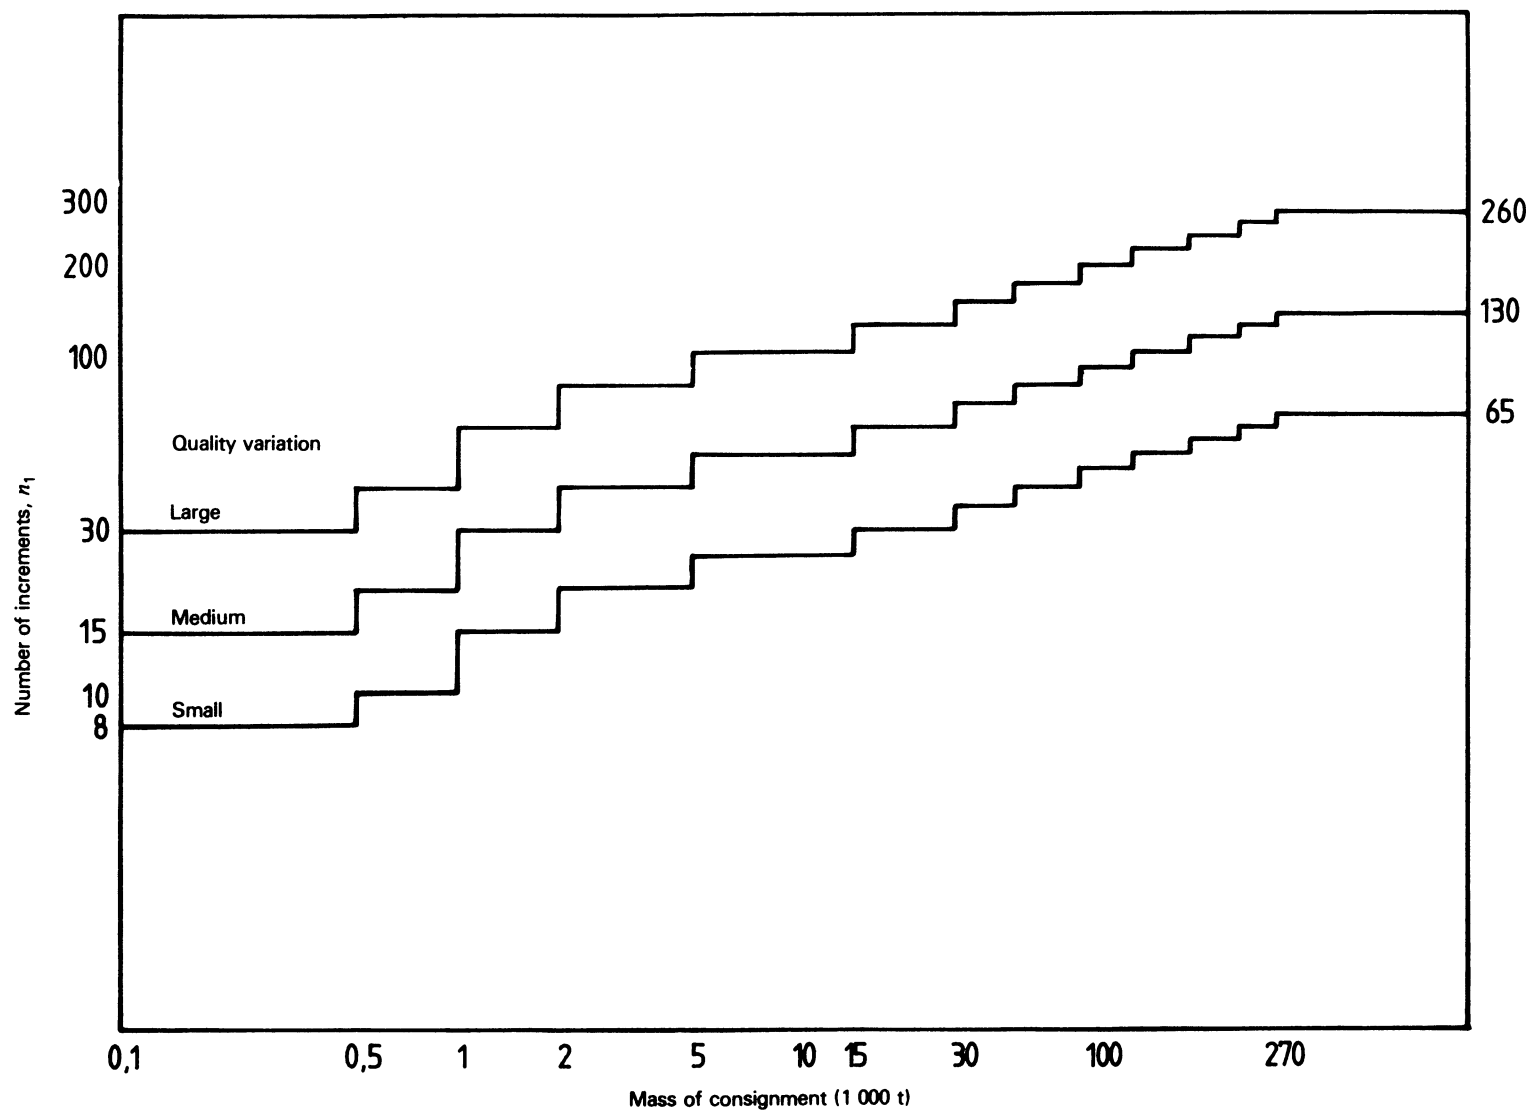

NOTE Figure 2 is a graphic illustration of the minimum number of increments in Table 4.

Figure 2 — Minimum number of increments required