

Ref:	NR/L2/ELP/27009/MOD C11
Issue:	1
Date:	03/12/2011
Compliance date:	03/03/2012
Page	1 of 2


OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET

11

REPLACEMENT OF PLASTIC DROPPER SLEEVES PRONE TO ULTRA VIOLET DEGRADATION

COMPONENT Black nylon / plastic dropper sleeves, OLEMI type 146/20/2

PROBLEM Dropper sleeves crack and detach from dropper, leading to a risk of the dropper fouling pantograph envelope.

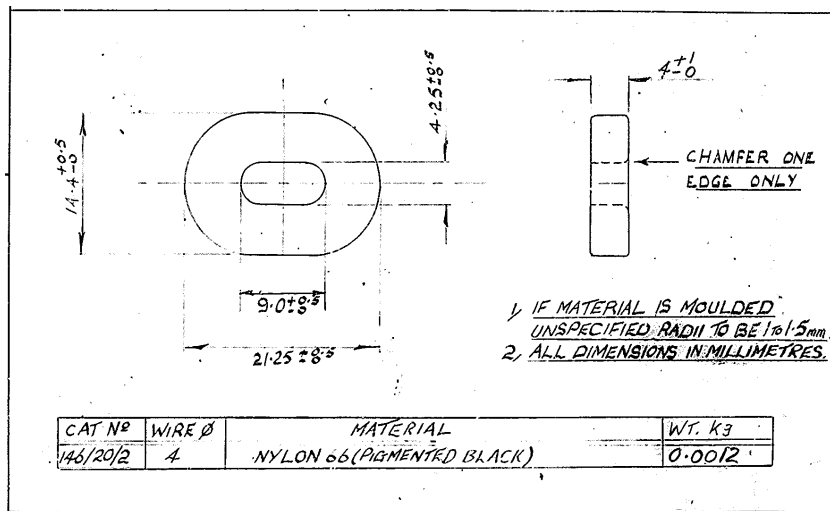

Reference Information

Ellipse standard job number	13011
Ellipse standard job description	Replace plastic dropper sleeves
Category	Dropper
Priority	Yes
Types of OLE affected	Ex-DC; Mk1; Mk2; Mk3; Mk3a; Mk3b; Mk3c
Original equipment dates	1977 - 1985



Documents
Document Sharing Hub

Ref:	NR/L2/ELP/27009/MOD C11
Issue:	1
Date:	03/12/2011
Compliance date:	03/03/2012
Page	2 of 2

OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET

11

REPLACEMENT OF PLASTIC DROPPER SLEEVES PRONE TO ULTRA VIOLET DEGRADATION

ACTION REQUIRED

Fit stainless steel type 91/10117 (OLEMI number 145/814/001) or keyring type 91/2435. The keyring type can be fitted to existing droppers.

