

Ref:	NR/L2/ELP/27009/MOD C24
Issue:	1
Date:	03/12/2011
Compliance date:	03/03/2012
Page	1 of 6

OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET											
24	REPLACEMENT OF 19/3.2mm COPPER DEAD END GRIPS										
COMPONENT	Copper dead end grips for 19/3.2mm copper conductor (OLEMI reference 121/091/011).										
PROBLEM	Copper dead end grips are prone to lose the adhesive and sand binding coating. This causes the conductor to slip and suffer a rapid loss of tension.										
ACTION REQUIRED	Where 19/3.2mm copper tail wire has suffered a rapid loss of tension, replace dead end grips as follows:										
	<table><tr><td>Description</td><td>OLEMI reference</td><td>PADS number</td></tr><tr><td>Forked collar socket</td><td>121/544/022</td><td>091/012553</td></tr><tr><td>Cone end fitting</td><td>124/083/001</td><td>091/002482</td></tr></table>		Description	OLEMI reference	PADS number	Forked collar socket	121/544/022	091/012553	Cone end fitting	124/083/001	091/002482
Description	OLEMI reference	PADS number									
Forked collar socket	121/544/022	091/012553									
Cone end fitting	124/083/001	091/002482									

Reference Information	
Ellipse standard job number	13024
Ellipse standard job description	Replace 19/3.2mm copper dead end grip
Category	Wires
Priority	Yes
Types of OLE affected	Mk3a, Mk3b
Original equipment dates	1985 - 1990



Ref:	NR/L2/ELP/27009/MOD C24
Issue:	1
Date:	03/12/2011
Compliance date:	03/03/2012
Page	2 of 6


OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET

24

REPLACEMENT OF 19/3.2mm COPPER DEAD END GRIPS



From top, dead end grip 121/091/011; cone end fitting 124/083/001; forked collar socket 121/544/022.

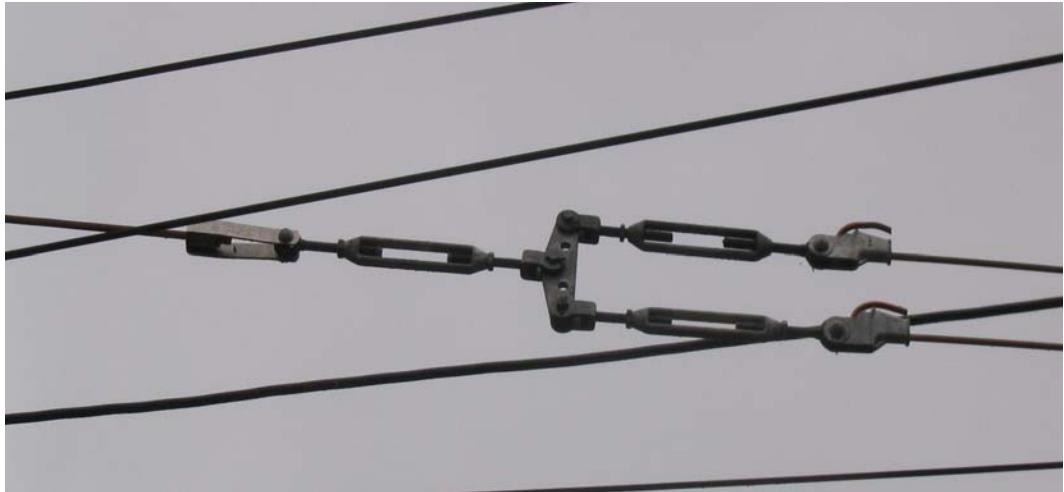

19/3.2mm tail wire with forked collar socket 121/544/022 fitted.