


Ref:	NR/L2/ELP/27009/MOD C30
Issue:	1
Date:	03/12/2011
Compliance date:	03/03/2012
Page	1 of 4

OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET	
30	REPLACEMENT OF PTFE ROD INSULATORS WITH 'O' RING END FITTING SEALS
COMPONENT	PTFE insulators with rubber O-ring seals, to drawings to drawings K70811 and K70812.
PROBLEM	Ionised water ingress past the O-ring seals causes the insulators to fail and part, because of acid erosion of the glass fibre core.
	
ACTION REQUIRED	Replace insulators with OLEMI / Mark 3 type glass fibre insulation to drawing 1/121/006.

Reference Information	
Ellipse standard job number	13030
Ellipse standard job description	Replace PTFE rod INS with 'O' ring seals
Category	Insulation
Priority	No
Types of OLE affected	Mk1; Mk2
Original equipment dates	1958 - 1969

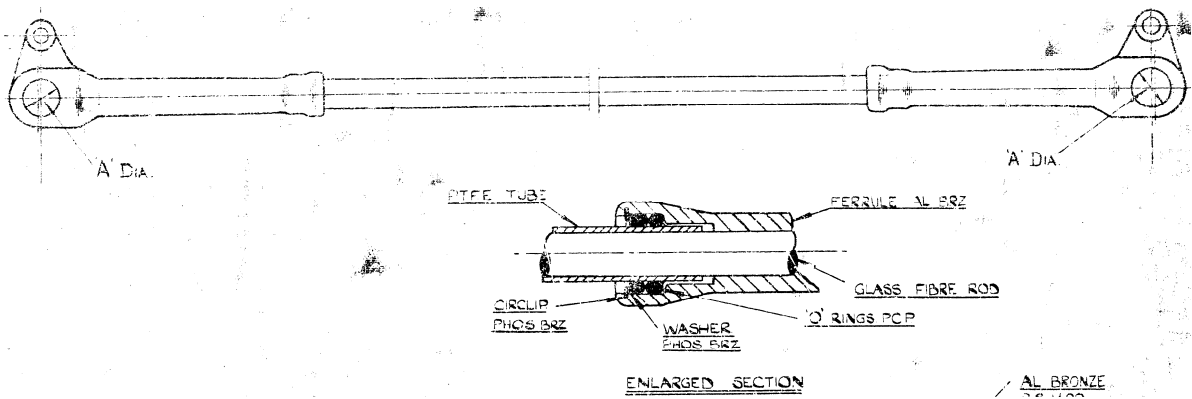