

Ref:	NR/L2/ELP/27009/MOD C40
Issue:	1
Date:	03/12/2011
Compliance date:	03/03/2012
Page	1 of 4


OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET

40

REPLACEMENT OF 'PEA SHOOTER' TYPE BI METAL CONNECTIONS TO AWAC CATENARY

COMPONENT 'Pea shooter' bi metallic connector for AWAC catenary.

PROBLEM This type of connector is prone to dissimilar metal corrosion. This gives a high resistance connection which leads in turn to dropper and catenary damage.

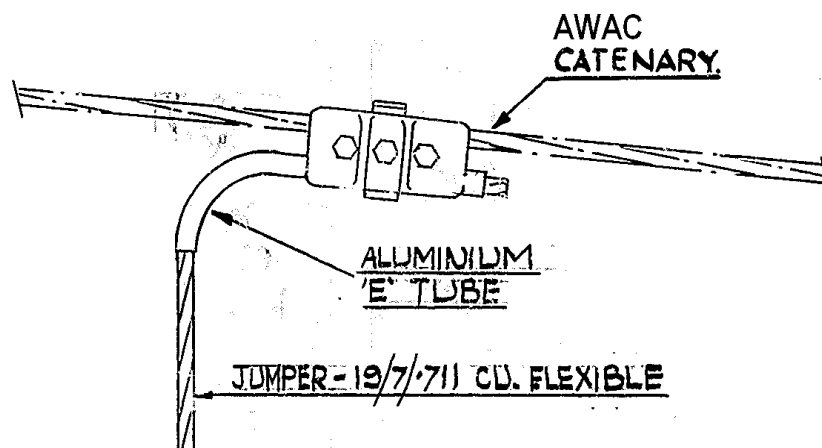

Reference Information	
Ellipse standard job number	13040
Ellipse standard job description	Replace pea shooter bimetal AWAC Conrs
Category	Catenary wire
Priority	Yes
Types of OLE affected	Mk3a; Mk3b
Original equipment dates	1970 - 1980



Documents
Document Sharing Hub

Ref:	NR/L2/ELP/27009/MOD C40
Issue:	1
Date:	03/12/2011
Compliance date:	03/03/2012
Page	2 of 4

OVERHEAD LINE CAMPAIGN CHANGES – DATA SHEET

40

REPLACEMENT OF 'PEA SHOOTER' TYPE BI METAL CONNECTIONS TO AWAC CATENARY

ACTION REQUIRED

Replace with 20mm diameter bi-metal spill rod and wedge clamp as follows:

Item	OLEMI	PADS
20mm spill rod	121/815/004	091/011862
Wedge clamp	121/813/002	091/002270
PG clamp	125/003/001	091/020699

