


Patrol Route Plan

Central Line Route CD5 : Woodford to Grange Hill (Both Roads)



R2726, Issue: A1, January 2014

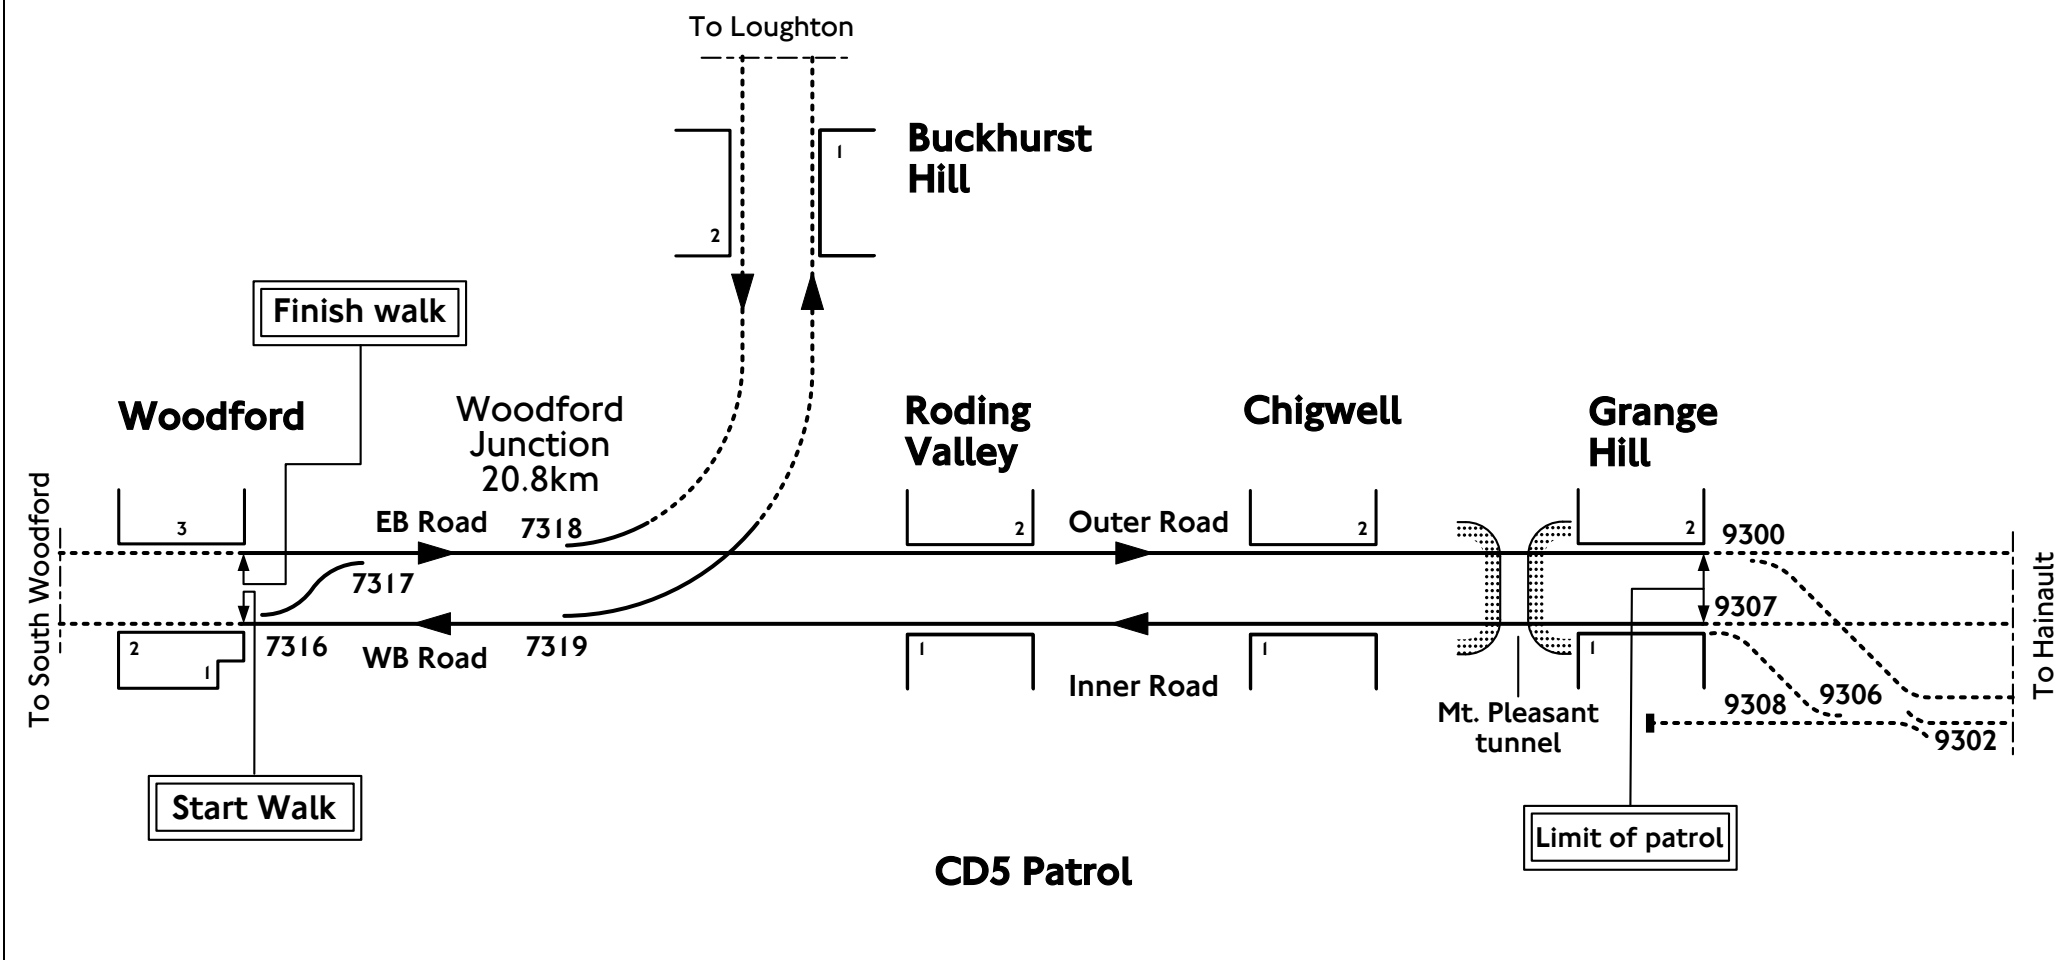

Central Line Route CD5 : Woodford to Grange Hill (Both Roads)

Patrol starts at the east end of Woodford platform 2 at
LCS C035/CWBFA 0m

Obtain briefing and travel to Woodford Station.

Set up the protection arrangements and patrol the westbound/ inner road eastwards from the start to the toes of 7319 points.

Inspect all P&C associated with 7316 and 7319 points.

Patrol the inner road eastwards to the east end of platform 1 at Grange Hill, LCS C057/CIRLO 0m, including the platforms 1 of Roding Valley and Chigwell.

Cross over onto the outer road at the east end of platform 2 at Grange Hill and patrol westwards to the toes of 7318 points, including platforms 2 of Chigwell and Roding Valley.

Inspect all P&C associated with 7318 points and the diamond of the double junction.

Patrol the eastbound road westwards from the toes of 7318 to east end of Woodford platform 3, LCS C035/CEBFA 142m and finish the patrol.

Inspect all P&C associated with 7317 points.

Complete the patrol reporting process as in W1328 Patrolling the track.

Items needing particular attention

Check for:

- Broken crossing bolts, broken chairs/baseplates, safety blocks, sidecut, wear and damage and wear to P&C on 7316, 7317, 7318 and 7319 points.
- Cracks on stretcher bars
- Scrap and report
- Junction plates, which should be clearly marked.
- Corrosion from dripping bridges on rails.
- Debris and ballast in all fixtures and fittings.
- Any line side storage licences which must have correct date shown.
- Broken juice pots, anchors.
- Wet beds
- Bad top and line, bad sleeper alignment, sidecut and wear.
- Vegetation problems
- Drainage problems