


Patrol Route Plan

Central Line Route CN10: Stratford to Leytonstone (Both Roads)



R2731, Issue: A1, January 2014

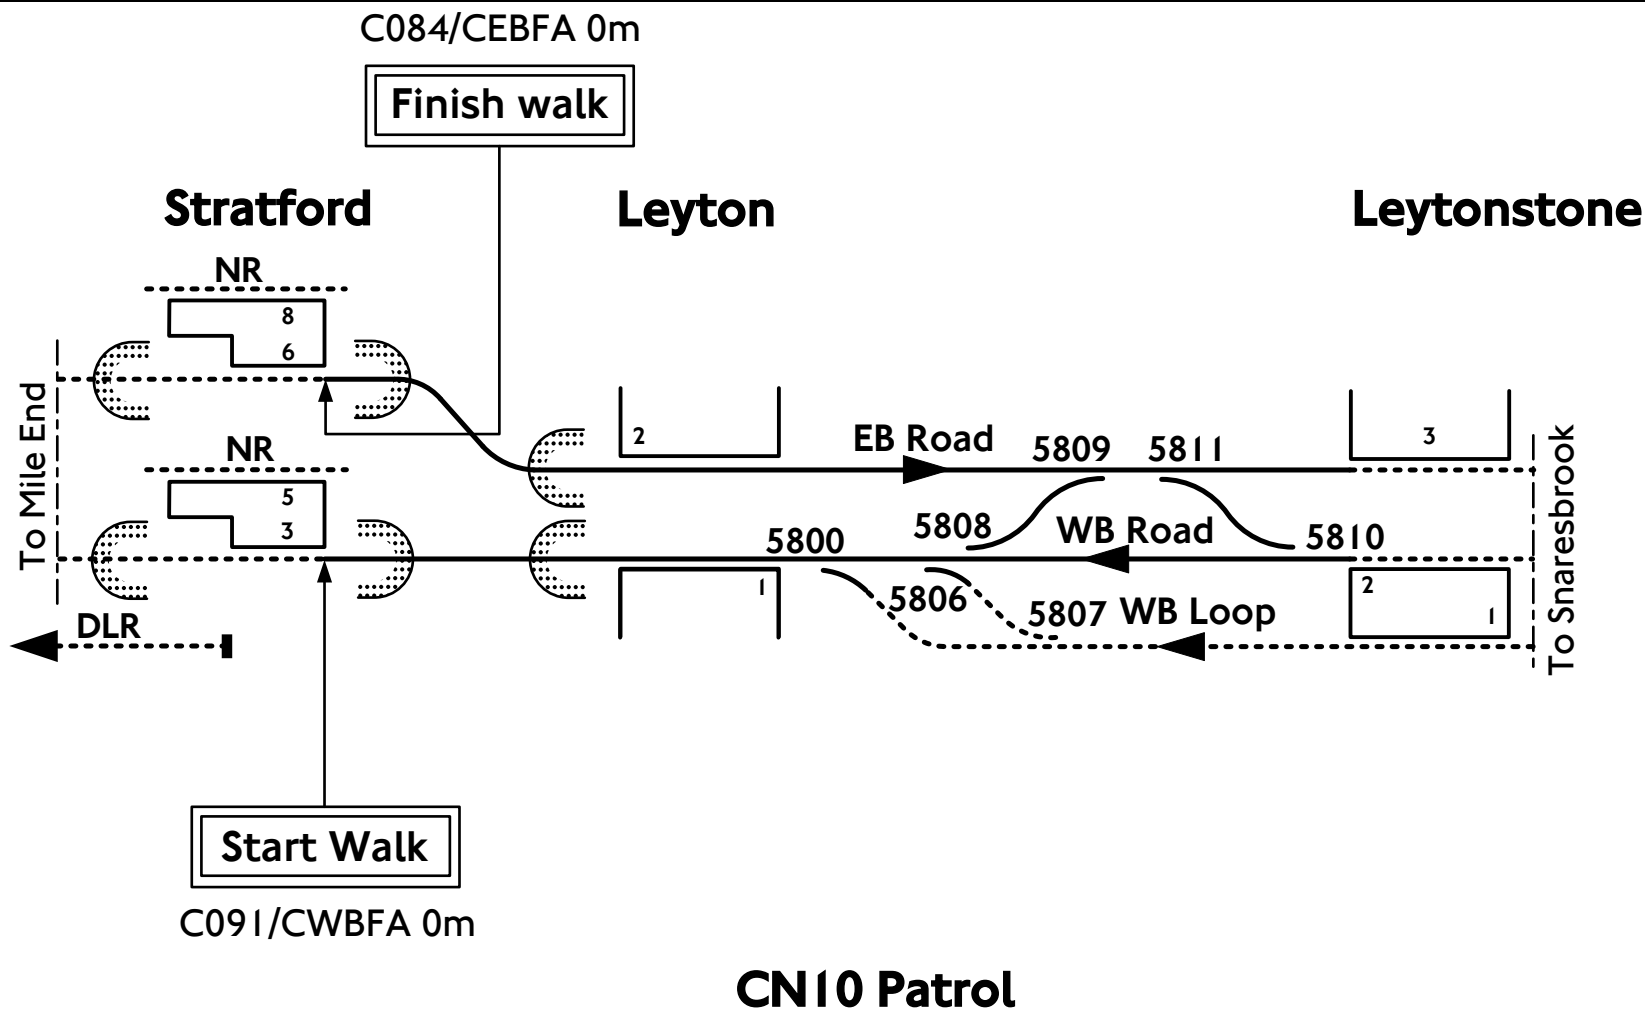

CN10 Patrol

Central Line Route CN10: Stratford to Leytonstone (Both Roads)

Patrol starts at the east end of Stratford, platform 3
LCS C091/CWBFA 0m

Obtain briefing from supervisor and travel to Stratford Station.

Once traction current has been discharged and protection arrangements are in place, patrol eastwards on the westbound road from the start to the west end of Leytonstone platform 2, via Leyton platform 1, 5800, 5806, 5808 and 5810 points.

Inspect all P&C associated with 5800, 5806, 5808 and 5810 points.

Cross over to the west end of Leytonstone platform 3 and patrol the eastbound road westwards to the east end of Stratford platform 6, LCS CO84/CEBFA 0m, via 5811 and 5809 points and Leyton platform 2.

Inspect all P&C associated with 5811 and 5809 points and finish the patrol.

Complete the patrol reporting process as in W1328 Patrolling the track.

Items needing particular attention

Check for:

- Broken crossing bolts, broken chairs/baseplates, safety blocks, sidecut, wear and damage and wear to P&C on 5800, 5806, 5808, 5809, 5810 and 5811 points.
- Cracks on stretcher bars.
- Scrap and report.
- Junction plates, which should be clearly marked.
- Corrosion from dripping structures on rails.
- Debris and ballast in all fixtures and fittings.
- Any line side storage licences which must have correct date shown.
- Broken juice pots, anchors.
- Wet beds.
- Bad top and line, bad sleeper alignment, sidecut and wear.
- Vegetation problems.
- Drainage problems.