


Patrol Route Plan

Central Line Route CD20: Ealing Broadway to West Acton and Bridge ES31 (Both Roads)



R2741, Issue: A1, January 2014

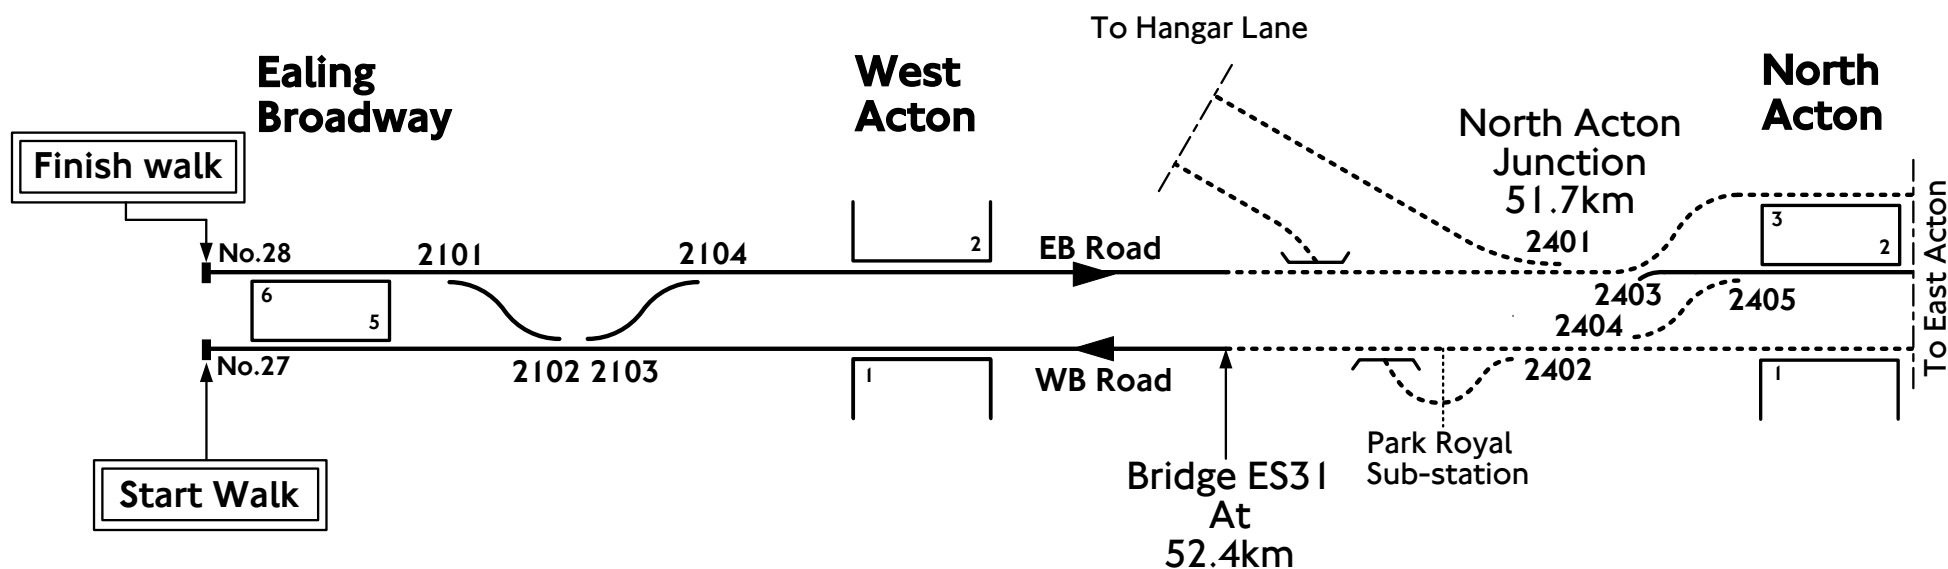

CD20 Patrol

Central Line Route CD20: Ealing Broadway to West Acton and Bridge ES31 (Both Roads)

Patrol starts at the buffer stop at the west end of Ealing Broadway platform 5.

Obtain briefing from supervisor and travel to Ealing Broadway Station.

Set up the protection arrangements and walk to the buffer stop on No 27 road at the west end of Ealing Broadway Station.

Patrol the westbound road eastwards from the start to bridge ES31 at 52.4km, via Ealing Broadway platform 5, 2102 & 2103 points and West Acton platform 1.

Inspect all P&C associated with 2102 and 2103 points.

Cross over the bridge to the eastbound road and patrol westwards to the buffer stop at the end of Ealing Broadway No 28 road, via West Acton platform 2, 2104 & 2101 points and Ealing Broadway platform 6.

Inspect all P&C associated with 2104 and 2101 points.

Finish the patrol at buffer stop at the end of Ealing Broadway No 28 road.

Complete the patrol reporting process as in W1328 Patrolling the track.

Items needing particular attention

Check for:

- Broken crossing bolts, broken chairs/baseplates, safety blocks, sidecut, wear and damage and wear to P&C on 2101, 2102, 2103 and 2104 points.
- Cracks on stretcher bars.
- Scrap and report.
- Junction plates, which should be clearly marked.
- Corrosion from dripping structures on rails.
- Debris and ballast in all fixtures and fittings.
- Any line side storage licences which must have correct date shown.
- Broken juice pots, anchors.
- Wet beds.
- Bad top and line, bad sleeper alignment, sidecut and wear.
- Vegetation problems.
- Drainage problems.
- Red bonds on Network Rail overhead power cables.