


Patrol Route Plan

Central Line Route CN21A: Hanger Lane to North Acton EB



R2742, Issue: A1, January 2014

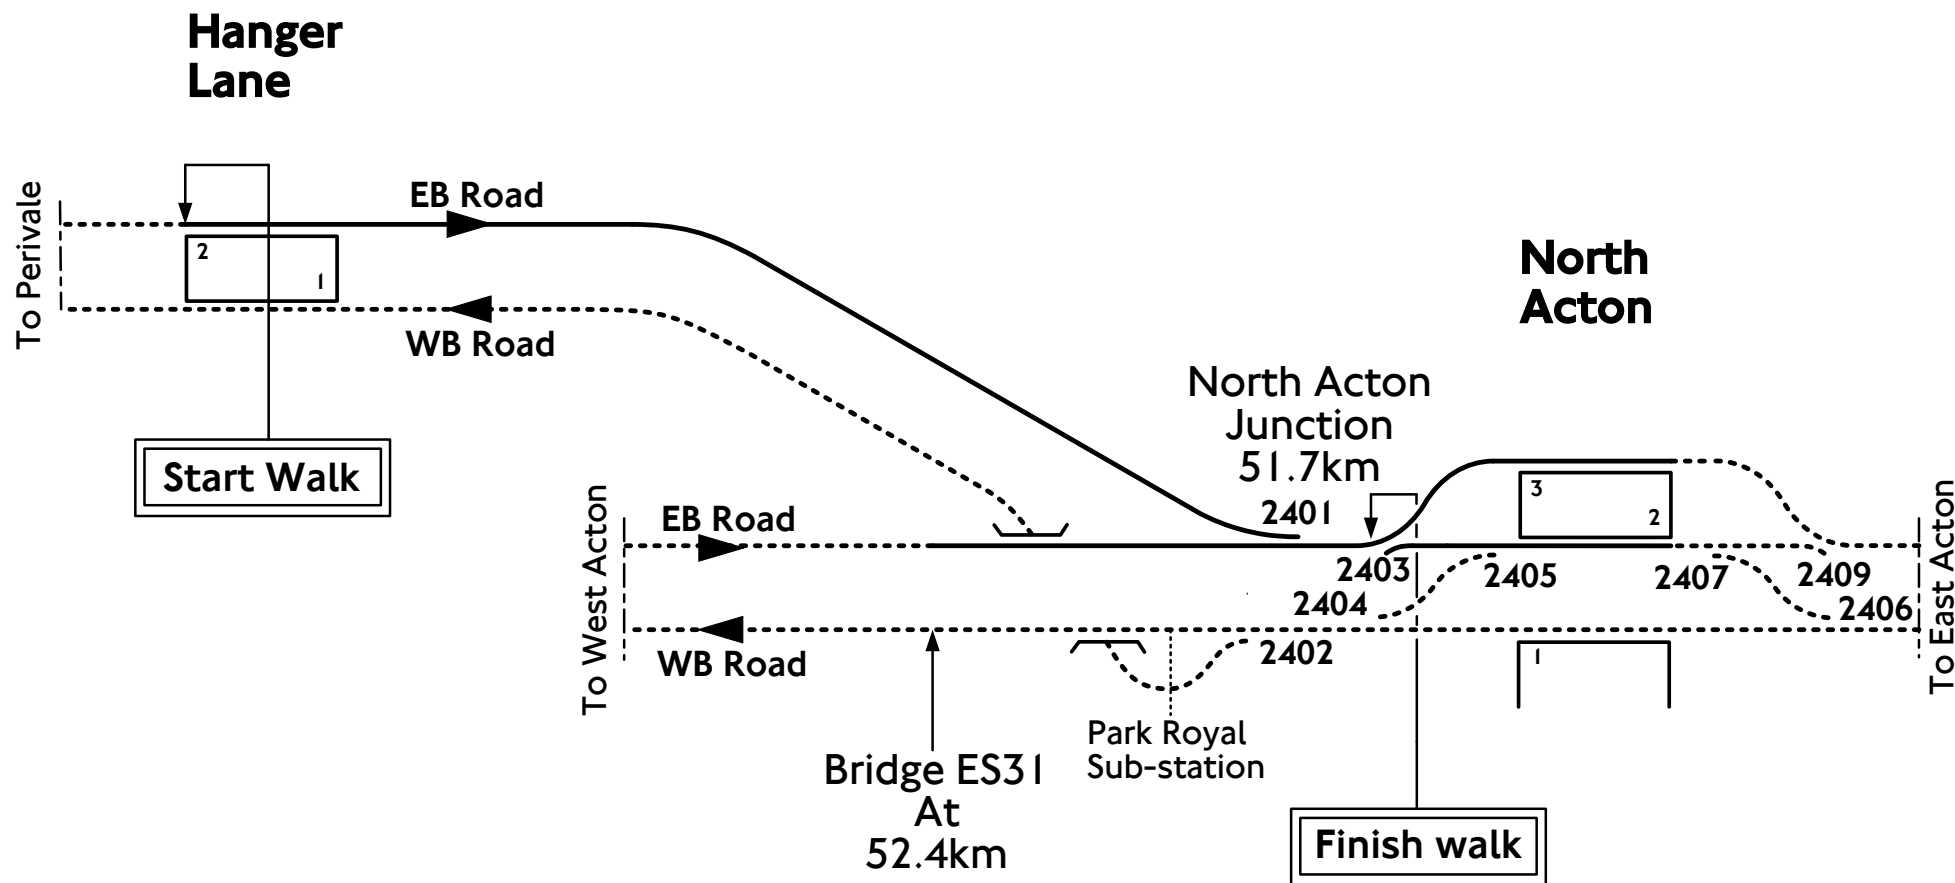

CN21A Patrol

Central Line Route CN21A: Hanger Lane to North Acton EB

Patrol starts at the west end of Hanger Lane platform 2.
LCS C153/CEBFA 0m

Obtain briefing from supervisor and travel to Hanger Lane Station.
 Once traction current has been discharged and protection arrangements are in place, patrol the eastbound road eastwards to the toes of 2401 points.
 Inspect all P&C associated with 2401 points.
 Patrol the eastbound (Ealing Broadway) road westwards towards bridge ES31 at 52.4km.
 End this part of the patrol at bridge ES31 and dead walk back to the toes of 2401 points.
 Patrol eastwards on the eastbound road to the east end of North Acton platform 3, via 2403 points.
 Inspect all P&C associated with 2403 points.
 Cross over to the east end of North Acton platform 2 and patrol the middle road westwards to the toes of 2403 points to finish the patrol.
 Inspect all P&C associated with 2405 points.
 Complete the patrol reporting process as in W1328 Patrolling the track.

Items needing particular attention

Check for:

- Broken crossing bolts, broken chairs/baseplates, safety blocks, sidecut, wear and damage and wear to P&C on 2401, 2403 and 2705 points.
- Cracks on stretcher bars.
- Scrap and report.
- Junction plates, which should be clearly marked.
- Corrosion from dripping structures on rails.
- Debris and ballast in all fixtures and fittings.
- Any line side storage licences which must have correct date shown.
- Broken juice pots, anchors.
- Wet beds.
- Bad top and line, bad sleeper alignment, sidecut and wear.
- Vegetation problems.
- Drainage problems.
- Red bonds on Network Rail overhead power cables.